# Fire detection and fire alarm systems.

Part 12: Smoke detectors — Line detectors using an optical light beam



Adjustment : Ali Mohammad Akhavan

**DATE:** 10 june 2017

The European Standard EN 54-12:2002 has the status of a British Standard

ICS 13.220.20



### **National foreword**

This British Standard is the official English language version of EN 54-12:2002.

The UK participation in its preparation was entrusted by Technical Committee FSH/12, Fire detection and alarm systems, to Subcommittee FSH/12/2, Fire detectors, which has the responsibility to:

- aid enquirers to understand the text;
- present to the responsible international/European committee any enquiries on the interpretation, or proposals for change, and keep the UK interests informed;
- monitor related international and European developments and promulgate them in the UK.

A list of organizations represented on this subcommittee can be obtained on request to its secretary.

#### Cross-references

The British Standards which implement international or European publications referred to in this document may be found in the *BSI Catalogue* under the section entitled "International Standards Correspondence Index", or by using the "Search" facility of the *BSI Electronic Catalogue* or of British Standards Online.

This publication does not purport to include all the necessary provisions of a contract. Users are responsible for its correct application.

Compliance with a British Standard does not of itself confer immunity from legal obligations.

#### Summary of pages

This document comprises a front cover, an inside front cover, the EN title page, pages 2 to 52, an inside back cover and a back cover.

The BSI copyright notice displayed in this document indicates when the document was last issued.

#### Amendments issued since publication

	Amd. No.	Date	Comments
-			

© BSI 31 July 2003

ISBN 0 580 42366 2

# EUROPEAN STANDARD NORME EUROPÉENNE EUROPÄISCHE NORM

EN 54-12

November 2002

ICS 13.220.20

#### **English version**

# Fire detection and fire alarm systems - Part 12: Smoke detectors - Line detectors using an optical light beam

Systèmes de détection et d'alarme incendie - Partie 12: Détecteurs de fumée - Détecteurs linéaires fonctionnant suivant le principe de la transmission d'un faisceau d'ondes optiques rayonnées Brandmeldeanlagen - Teil 12: Rauchmelder - Linienförmiger Melder nach dem Durchlichtprinzip

This European Standard was approved by CEN on 19 August 2002.

CEN members are bound to comply with the CEN/CENELEC Internal Regulations which stipulate the conditions for giving this European Standard the status of a national standard without any alteration. Up-to-date lists and bibliographical references concerning such national standards may be obtained on application to the Management Centre or to any CEN member.

This European Standard exists in three official versions (English, French, German). A version in any other language made by translation under the responsibility of a CEN member into its own language and notified to the Management Centre has the same status as the official versions.

CEN members are the national standards bodies of Austria, Belgium, Czech Republic, Denmark, Finland, France, Germany, Greece, Iceland, Ireland, Italy, Luxembourg, Malta, Netherlands, Norway, Portugal, Spain, Sweden, Switzerland and United Kingdom.

UROPEAN COMMITTEE FOR STANDARDIZATION COMITÉ EUROPÉEN DE NORMALISATION EUROPÄISCHES KOMITEE FÜR NORMUNG

Management Centre: rue de Stassart, 36 B-1050 Brussels

© 2002 CEN All rights of exploitation in any form and by any means reserved worldwide for CEN national Members.

Ref. No. EN 54-12:2002 E

Copyright British Standards Institution Reproduced by IHS under license with BSI - Uncontrolled Copy No reproduction or networking permitted without license from IHS

# **Contents**

Forewor	d	5
1	Scope	6
2	Normative references	6
3	Terms and definitions	8
4	Requirements	9
4.1	Compliance	
4.2	Individual alarm indication	
4.3	Connection of ancillary devices	
4.4	Manufacturer's adjustments	
4.5	On-site adjustment of response threshold value	
4.6	Protection against ingress of foreign bodies	
4.7	Monitoring of detachable detectors and connections	
4.8	Limit of compensation	
4.9	Additional requirements for software controlled detectors	
4.9.1	General	
4.9.2	Software design	10
4.9.3	Software design  The storage of programs and data	10
4.10	Fault signalling	10
5	Test methods	11
5.1	General	11
5.1.1	Atmospheric conditions for tests	
5.1.2	Operating conditions for tests	11
5.1.3	Mounting arrangements	
5.1.4	Tolerances	11
5.1.4	Measurement of response threshold value	11
5.1.6		
5.1.7	Provision for tests	12
5.1.7		
5.2 5.2.1	Reproducibility	14 14
5.2.1	Object	
5.2.2		14
	Requirements	14
5.3 5.3.1	Repeatability	14
	Object	14
5.3.2 5.3.3	Test procedure	14
	Requirements	14
5.4	Directional dependence	15
5.4.1	Object	15
5.4.2	Test procedure	15
5.4.3	Requirements	15
5.5	Variation of supply parameters	16
5.5.1	Object	16
5.5.2	Test procedure	16
5.5.3	Requirements	16
5.6	Rapid changes in attenuation	16
5.6.1	Object	16
5.6.2	Test procedure	16
5.6.3	Requirements	16
5.7	Slow changes in attenuation	17
5.7.1	Object	17
5.7.2	Test procedure	17
5.7.3	Requirements	17

6 Marking and data	5.8	Optical path length dependence	17
5.8.2 Fequirements 5.9 Fire sensitivity 5.9.1 Object 5.9.2 Test procedure 5.9.3 Requirements 5.10 Stray light 5.11 Dobject 5.10.2 Test procedure 5.10.3 Requirements 5.11 Dry heat (operational) 5.11.1 Object 5.11.2 Test procedure 5.11.3 Requirements 5.11 Dobject 5.11.2 Test procedure 5.11.3 Requirements 5.12 Cold (operational) 5.12.1 Object 5.12.1 Set procedure 5.13 Requirements 5.14 Dobject 5.15.1 Requirements 5.15 Na Pamp heat, steady state (operational) 5.11.3 Test procedure 5.13 Requirements 5.14 Dobject 5.14 Requirements 5.15 Na Pamp heat, steady state (operational) 5.15.1 Object 5.15 Na Requirements 5.16 Est procedure 5.17 Requirements 5.18 Requirements 5.19 Dobject 5.19 Requirements 5.19 Suph peat, steady state (endurance) 5.19 Requirements 5.11 Object 5.11 Requirements 5.12 Test procedure 5.15 Vibration (endurance) 5.15 Vibration (endurance) 5.15 Vibration (endurance) 5.16 Est corresponder compatibility (EMC), ignountry tests (operational) 5.17 Sulphur dioxide SO <sub>2</sub> corresion (endurance) 5.18 Requirements 5.19 Marking 6.10 Requirements 6.10 General 6.10 General 6.11 Object 6.12 Sulphur dioxide SO <sub>2</sub> corresion (endurance) 6.13 Requirements 6.14 Marking 6.15 Dioxide SO <sub>2</sub> corresponse threshold value measurements 6.16 Endering and data 6.17 Marking 6.18 Marking 6.2 Documentation 6.2 General 6.3 Arrangement 6.4 Heating rate 6.5 End of test condition	5.8.1	Object	17
5.8.3       Requirements         5.9       Fire sensitivity         5.9.2       Test procedure         5.9.2       Requirements         5.10       Stray light         5.10.1       Object         5.10.2       Test procedure         5.10.3       Requirements         5.11.0       Dry heat (operational)         5.11.1       Object         5.11.2       Test procedure         5.12.1       Object         5.12.2       Test procedure         5.12.3       Requirements         5.12.3       Paigurents         5.13.1       Object         5.12.2       Test procedure         5.13.1       Object         5.13.2       Test procedure         5.13.3       Requirements         5.14.2       Test procedure         5.13.1       Object         5.14.2       Test procedure         5.14.3       Requirements         5.14.2       Test procedure         5.15.3       Test procedure         5.15.1       Sulphur dioxide SQ corresion (endurance)         5.15.1       Sulphur dioxide SQ corresion (endurance)         5.15.2       Test procedure <td></td> <td></td> <td></td>			
Fire sensitivity 5.9.1 Object 5.9.2 Test procedure 5.9.3 Requirements 5.10 Stray light 5.10.1 Object 5.10.2 Test procedure 5.10.3 Requirements 5.11 Dry heat (operational) 5.11.1 Object 5.11.2 Test procedure 5.12 Cold (operational) 5.11.2 Test procedure 5.12 Sequirements 5.12 Sequirements 5.13 Requirements 5.14 Object 5.15.1 Object 5.15.1 Object 5.16 Diper Object 5.17 Sequirements 5.18 Sequirements 5.19 Damp heat, steady state (operational) 5.19 Damp heat, steady state (operational) 5.19 Damp heat, steady state (operational) 5.19 Damp heat, steady state (endurance) 5.14 Damp heat, steady state (endurance) 5.15 Diper Determine Sequirements 5.16 Vibration (endurance) 5.17 Septocedure 5.18 Requirements 5.19 Vibration (endurance) 5.110 Sulphur dioxide SO <sub>2</sub> condision (endurance) 5.110 Electromagnetic compatibility (EMC), injuminity tests (operational) 5.111 Object 5.112 Test procedure 5.113 Requirements 5.113 Damp heat, steady state (endurance) 5.114 Object 5.115 Diper Determine Sequirements 5.116 Diper Determine Sequirements 5.117 Object 5.118 Damp Heat, steady state (endurance) 5.119 Diper Determine Sequirements 5.110 Diper Determine Sequirements 5.111 Diper Determine Sequirements 6 Marking and data Sequirements 6 Marking Sequirements 6 Marking Sequirements 6 Marking Sequirements 6 Marking Sequirements 7 Determine Sequirements 8 (normative) Sento for response threshold value measurements 8 Decumentation Sequirements 8 (normative) Sento for response threshold value measurements 8 Decumentation Sequirements 8 Decumentation Sequi			
5.9.1 Test procedure         5.9.2 Test procedure         5.10 Stray light         5.10.1 Object         7.7.7.7.7.7.7.7.7.7.7.7.7.7.7.7.7.7.7.			
5.9.3 Requirements 5.10 Stray light 5.11 Object 5.10.2 Test procedure 5.10.3 Requirements 5.11 Dry heat (operational) 5.11.1 Object 5.11.2 Test procedure 5.11.3 Requirements 5.12 Cold (operational) 5.12 Test procedure 5.13 Requirements 5.14 Object 5.15 Stray (operational) 5.15 Stray (operational) 5.16 Stray (operational) 5.17 Test procedure 5.18 Requirements 5.19 Damp heat, steady state (operational) 5.19 Test procedure 5.	5.9.1		
5.9.3 Requirements 5.10.1 Object. 5.10.2 Test procedure 5.10.3 Requirements 5.11.1 Dry heat (operational). 5.11.1 Object. 5.11.2 Test procedure 5.11.3 Requirements 5.12 Cold (operational). 5.12.1 Object. 5.12.1 Sets procedure 5.12.3 Requirements 5.13 Damp heat, steady state (operational). 5.13.1 Object. 5.13 Damp heat, steady state (operational). 5.13.1 Object. 5.14 Damp heat, steady state (endurance). 5.14.1 Object. 5.14 Damp heat, steady state (endurance). 5.15 Doject. 5.16 Doject. 5.17 Doject. 5.18 Requirements. 5.19 Damp heat, steady state (endurance). 5.19 Damp heat, steady state (endurance). 5.11 Doject. 5.12 Test procedure 6.14.3 Requirements. 5.15 Doject. 5.16 Doject. 5.17 Doject. 5.18 Electromagnetic compatibility (EMC), immunity tests (operational). 5.19 Dipland dioxide SQz corqusion (endurance). 5.11.2 Test procedure 5.17.3 Requirements 5.18 Impact (operational). 5.19 Dipland dioxide SQz corqusion (endurance). 5.11.2 Test procedure 5.18.1 Requirements 5.19 Dipland (point dioxide SQz corqusion (endurance). 5.11.2 Test procedure 5.11.3 Requirements 5.11 Doject. 5.12 Test procedure 5.13 Requirements 6.1 Marking and data 6.1 Marking and data 6.2 Documentation 6.2 Software documentation 6.2 Software documentation 6.3 Arrangement. 6.4 Heating rate 6.5 Eiel of test condition		•	
5.10 Stray light			
5.10.1 Object 5.10.2 Test procedure 5.10.3 Requirements 5.11 Dry heat (operational) 5.11.1 Object 5.11.2 Test procedure 5.12 Cold (operational) 5.12.1 Object 5.13 Requirements 5.12 Stay procedure 5.14 Object 5.15.1 Damp heat, steady state (operational) 5.16 Damp heat, steady state (operational) 5.17 Stay procedure 5.18 Damp heat, steady state (endurance) 5.19 Damp heat, steady state (endurance) 5.10 Dipect 5.11 Dipict 5.12 Test procedure 5.13.3 Requirements 5.14 Damp heat, steady state (endurance) 5.14.1 Object 5.14.1 Object 5.15 Vibration (endurance) 5.16 Electromagnetic compatibility (EMC), immunity tests (operational) 5.17 Sulphur dioxide SO <sub>2</sub> corrusion (endurance) 5.17.1 Object 5.17.2 Test procedure 5.17.3 Requirements 5.18 Impact (operational) 5.19 Stay procedure 5.19 Stay procedure 5.10 Joict 5.11 Marking 5.12 Test procedure 5.13 Requirements 5.14 Marking 5.15 General 6.1 Marking 6.2 Documentation 6.2 Documentation 6.2.1 General 6.2 General 6.3 Marking and data 6.4 Marking and data 6.5 End of test condition 6.7 Healing rate 6.8 Healing rate 6.9 Healing rate 6.1 Healing rate 6.1 Healing rate 6.2 Healing rate 6.3 Healing rate 6.4 Healing rate 6.5 End of test condition			
5.10.2 Test procedure  5.10.3 Requirements  5.11.1 Dry heat (operational). 5.11.2 Test procedure 5.11.3 Requirements. 5.12 Cold (operational). 5.12.1 Object. 5.12.1 Object. 5.12.2 Test procedure 5.12.3 Requirements 5.13 Damp heat, steady state (operational). 5.13.1 Dobject. 5.13.1 Dobject. 5.13.2 Test procedure 5.13.3 Requirements 5.14 Damp heat, steady state (endurance). 5.15.1 Diject. 5.15.1 Diject. 5.16.1 Diject. 5.17.1 Object. 5.18.2 Test procedure 5.19.3 Requirements 5.19 Diject. 5.19 Diject. 5.10 Diject. 5.110 Diject. 5.111 Diject. 5.112 Test procedure 5.113 Requirements 5.114 Diject. 5.115 Object. 5.115 Object. 5.115 Object. 5.115 Object. 5.116 Electromagnetic compatibility (EMC), immunity tests (operational). 5.117 Diject. 5.118 Impact (operational). 5.119 Impact (operational). 5.110 Diject. 5.111 Object. 5.112 Test procedure 5.113.8 Requirements. 5.114 Impact (operational). 5.115 Object. 5.116 Electromagnetic compatibility (EMC), immunity tests (operational). 5.117 Object. 5.118 Impact (operational). 5.119 Columnative Bench for response threshold value measurements. 6.1 Marking and data. 6.1 Marking and data. 6.2 Documentation 6.2.1 General. 6.2.2 Software documentation 6.2.3 General. 6.3 Arrangement. 6.4 Heating rate 6.5 End of test condition.		, -g	
5.10.2 Test procedure  5.10.3 Requirements  5.11.1 Dry heat (operational). 5.11.2 Test procedure 5.11.3 Requirements. 5.12 Cold (operational). 5.12.1 Object. 5.12.1 Object. 5.12.2 Test procedure 5.12.3 Requirements 5.13 Damp heat, steady state (operational). 5.13.1 Dobject. 5.13.1 Dobject. 5.13.2 Test procedure 5.13.3 Requirements 5.14 Damp heat, steady state (endurance). 5.15.1 Diject. 5.15.1 Diject. 5.16.1 Diject. 5.17.1 Object. 5.18.2 Test procedure 5.19.3 Requirements 5.19 Diject. 5.19 Diject. 5.10 Diject. 5.110 Diject. 5.111 Diject. 5.112 Test procedure 5.113 Requirements 5.114 Diject. 5.115 Object. 5.115 Object. 5.115 Object. 5.115 Object. 5.116 Electromagnetic compatibility (EMC), immunity tests (operational). 5.117 Diject. 5.118 Impact (operational). 5.119 Impact (operational). 5.110 Diject. 5.111 Object. 5.112 Test procedure 5.113.8 Requirements. 5.114 Impact (operational). 5.115 Object. 5.116 Electromagnetic compatibility (EMC), immunity tests (operational). 5.117 Object. 5.118 Impact (operational). 5.119 Columnative Bench for response threshold value measurements. 6.1 Marking and data. 6.1 Marking and data. 6.2 Documentation 6.2.1 General. 6.2.2 Software documentation 6.2.3 General. 6.3 Arrangement. 6.4 Heating rate 6.5 End of test condition.	5.10.1	Object	20
5.10.3 Requirements 5.11.1 Dry heat (operational). 5.11.1 Object. 5.11.2 Test procedure 5.11.3 Requirements 5.12 Cold (operational). 5.12.1 Object. 5.12.2 Test procedure 5.12.3 Requirements 5.12.3 Requirements 5.13 Damp heat, steady state (operational). 5.13.1 Object. 5.14.1 Object. 5.14.2 Test procedure 5.14.3 Requirements 5.14 Damp heat, steady state (endurance) 5.14.1 Object. 5.14.1 Object. 5.14.2 Test procedure 5.14.3 Requirements 5.15 Ibject. 5.16.1 Object. 5.17.1 Object. 5.18.1 Deliged. 5.19.1 Object. 5.19.1 Deliged. 5.19.1 Object. 5.			-
5.10.3 Requirements. 5.11.1 Dry heat (operational). 5.11.2 Test procedure 5.11.3 Requirements. 5.12 Cold (operational). 5.12.1 Object. 5.12.3 Requirements. 5.12.3 Requirements. 5.13.1 Dipicct. 5.13.1 Dipicct. 5.13.1 Dipicct. 5.13.1 Object. 5.13.1 Object. 5.13.3 Requirements. 5.14.1 Damp heat, steady state (operational). 5.13.1 Requirements. 5.13.3 Requirements. 5.14.1 Damp heat, steady state (endurance). 5.14.2 Test procedure. 5.14.3 Requirements. 5.15.1 Vibration (endurance). 5.15.1 Vibration (endurance). 5.15.1 Vibration (endurance). 5.15.1 Vibration (endurance). 5.15.1 Electromagnetic compatibility (EMC), inhumity tests (operational). 5.17 Suphur dioxide SO <sub>2</sub> corrosion (endurance). 5.17.1 Requirements. 5.18.1 Requirements. 5.18.1 Requirements. 5.19.1 Impact (operational). 5.18.1 Dipicct. 5.18.2 Test procedure. 5.18.3 Requirements. 5.18.1 Object. 5.18.3 Requirements. 5.18.1 Object. 5.18.2 Test procedure. 5.18.3 Requirements. 5.18.3 Requirements. 5.18.1 Object. 5.18.1 Object. 5.18.2 Test procedure. 5.18.3 Requirements. 6.1 Marking and data. 6.1 Marking and data. 6.2 Documentation. 6.2.1 General. 6.2 Documentation. 6.2 Documentation. 6.2 General. 6.3 Contractive) Bench for response threshold value measurements. 6.1 Technical characteristics of the attenuators. 6.2 Measuring bench. 6.3 Arrangement. 6.4 Heating rate. 6.5 End of test condition.	5.10.2	Test procedure	20
5.11. Dry heat (operational) 5.11.1 Object 5.11.2 Test procedure 5.11.3 Requirements 5.12 Cold (operational) 5.12.1 Object 5.12.1 Sex procedure 5.12.3 Requirements 5.13 Damp heat, steady state (operational) 5.13.1 Object 5.13.2 Test procedure 5.13.3 Requirements 5.14 Damp heat, steady state (operational) 5.15.1 Dobject 5.15.3 Requirements 5.16 Damp heat, steady state (endurance) 5.16.1 Damp heat, steady state (endurance) 5.16.1 Dobject 5.16.1 Object 5.16.1 Object 5.16.2 Test procedure 5.16.3 Requirements 5.16.3 Requirements 5.16.3 Requirements 5.16.1 Object 5.16.1 Object 5.16.2 Test procedure 5.16.3 Requirements 5.16.3 Requirements 5.17 Sulphur dioxide SO <sub>2</sub> corrosion (endurance) 5.17.1 Object 5.17.2 Test procedure 5.17.3 Requirements 5.18 Impact (operational) 5.18.1 Object 5.18.1 Object 5.18.1 Object 5.18.3 Requirements 6 Marking and data 6.1 Marking 6.2 Documentation 6.2 General 6.2 General 6.2 Software documentation 6.3 Marking and data 6.4 Marking 6.5 Documentation 6.6 Marking 6.7 Documentation 6.8 Marking and data 6.1 Marking 6.2 Documentation 6.3 General 6.4 Marking 6.5 Technical characteristics of the attenuators 6 Marking and data 6.1 Marking 6.2 Documentation 6.3 Arrangement 6.4 Feelingle Feel test room 6.5 End of test condition 6.7 Fulloplate 6.8 Arrangement 6.9 Feelingle Feel School of the attenuators 6 Marking and data 6 Heating tate 6 Heating tate 6 God of test condition	_	·	
5.11. Dry heat (operational) 5.11.1 Object 5.11.2 Test procedure 5.11.3 Requirements 5.12 Cold (operational) 5.12.1 Object 5.12.1 Sex procedure 5.12.3 Requirements 5.13 Damp heat, steady state (operational) 5.13.1 Object 5.13.2 Test procedure 5.13.3 Requirements 5.14 Damp heat, steady state (operational) 5.15.1 Dobject 5.15.3 Requirements 5.16 Damp heat, steady state (endurance) 5.16.1 Damp heat, steady state (endurance) 5.16.1 Dobject 5.16.1 Object 5.16.1 Object 5.16.2 Test procedure 5.16.3 Requirements 5.16.3 Requirements 5.16.3 Requirements 5.16.1 Object 5.16.1 Object 5.16.2 Test procedure 5.16.3 Requirements 5.16.3 Requirements 5.17 Sulphur dioxide SO <sub>2</sub> corrosion (endurance) 5.17.1 Object 5.17.2 Test procedure 5.17.3 Requirements 5.18 Impact (operational) 5.18.1 Object 5.18.1 Object 5.18.1 Object 5.18.3 Requirements 6 Marking and data 6.1 Marking 6.2 Documentation 6.2 General 6.2 General 6.2 Software documentation 6.3 Marking and data 6.4 Marking 6.5 Documentation 6.6 Marking 6.7 Documentation 6.8 Marking and data 6.1 Marking 6.2 Documentation 6.3 General 6.4 Marking 6.5 Technical characteristics of the attenuators 6 Marking and data 6.1 Marking 6.2 Documentation 6.3 Arrangement 6.4 Feelingle Feel test room 6.5 End of test condition 6.7 Fulloplate 6.8 Arrangement 6.9 Feelingle Feel School of the attenuators 6 Marking and data 6 Heating tate 6 Heating tate 6 God of test condition	5.10.3	Requirements	20
5.11.1 Object         5.11.2 Test procedure         5.11.3 Requirements         5.12.1 Object         5.12.2 Test procedure         5.12.3 Requirements         5.13.0 Damp heat, steady state (operational)         5.13.1 Object         5.13.2 Test procedure         5.13.2 Test procedure         5.13.2 Test procedure         5.14.1 Damp heat, steady state (endurance)         5.14.2 Test procedure         5.14.3 Requirements         5.14.3 Requirements         5.15.3 Vibration (endurance)         5.15.1 Object         5.15.2 Test procedure         5.15.3 Requirements         5.16 Electromagnetic compatibility (EMC), immunity tests (operational)         5.17 Sulphur dioxide SO <sub>2</sub> corrosion (endurance)         5.17.1 Object         5.17.2 Test procedure         5.18.1 Impact (operational)         5.18.2 Test procedure         5.18.3 Requirements         5.18.0 Dispect         5.18.2 Test procedure         5.18.3 Requirements         5.18.2 Test procedure         5.18.3 Requirements         6.4 Marking and data         6.1 Marking and data         6.2.1 General         6.2.2 Software documentation <tr< td=""><td>`-```</td><td></td><td></td></tr<>	`-```		
5.11.1 Object         5.11.2 Test procedure         5.11.3 Requirements         5.12.1 Object         5.12.2 Test procedure         5.12.3 Requirements         5.13.0 Damp heat, steady state (operational)         5.13.1 Object         5.13.2 Test procedure         5.13.2 Test procedure         5.13.2 Test procedure         5.14.1 Damp heat, steady state (endurance)         5.14.2 Test procedure         5.14.3 Requirements         5.14.3 Requirements         5.15.3 Vibration (endurance)         5.15.1 Object         5.15.2 Test procedure         5.15.3 Requirements         5.16 Electromagnetic compatibility (EMC), immunity tests (operational)         5.17 Sulphur dioxide SO <sub>2</sub> corrosion (endurance)         5.17.1 Object         5.17.2 Test procedure         5.18.1 Impact (operational)         5.18.2 Test procedure         5.18.3 Requirements         5.18.0 Dispect         5.18.2 Test procedure         5.18.3 Requirements         5.18.2 Test procedure         5.18.3 Requirements         6.4 Marking and data         6.1 Marking and data         6.2.1 General         6.2.2 Software documentation <tr< td=""><td>E 11</td><td>Dry heat (operational)</td><td>21</td></tr<>	E 11	Dry heat (operational)	21
5.11.2 Test procedure         5.12.1 Object         5.12.2 Test procedure         5.12.3 Requirements         5.12.3 Requirements         5.13.1 Object         5.13.1 Object         5.13.2 Test procedure         5.13.3 Requirements         5.14.0 Damp heat, steady state (endurance)         5.14.1 Object         5.14.2 Test procedure         5.14.3 Requirements         5.15 Vibration (endurance)         5.15.5 Vibration (endurance)         5.15.5 Test procedure         5.15.7 Sulphur dioxide SO <sub>2</sub> corresion (endurance)         5.17.1 Object         5.17.2 Test procedure         5.17.1 Object         5.17.2 Requirements         5.18 Requirements         5.18 Impact (operational)         5.18.1 Requirements         6.18 Procedure         5.18.2 Test procedure         5.18.3 Requirements         6.6 Marking and data         6.1 Marking         6.2 Documentation         6.2.1 General         6.2.2 Software documentation         Annex A (normative) Bench for response threshold value measurements         A.1 Technical characteristics of the attenuators         Anex Mornative Smouldering pyrolysis wood fire (TF2)	-		
5.11.3 Requirements. 5.12.1 Object 5.12.2 Test procedure 5.12.3 Requirements. 5.13.1 Damp heat, steady state (operational). 5.13.1 Object 5.13.2 Test procedure 5.13.3 Requirements. 5.13.3 Requirements. 5.14 Damp heat, steady state (endurance). 5.15.1 Damp heat, steady state (endurance). 5.14.1 Object 5.14.2 Test procedure 5.15.1 Side to the state of the			
5.12.1 Object           5.12.2 Test procedure           5.12.3 Requirements           5.13 Damp heat, steady state (operational)           5.13.1 Object           5.13.2 Test procedure           5.13.3 Requirements           5.14.1 Damp heat, steady state (endurance)           5.14.2 Test procedure           5.14.3 Requirements           5.15 Vibration (endurance)           5.15.1 Object           5.15.2 Test procedure           5.15.3 Requirements           5.15.3 Requirements           5.15.3 Requirements           5.16.3 Requirements           5.17.3 Requirements           5.18.1 Object           5.17.1 Object           5.17.2 Test procedure           5.17.3 Requirements           5.18 Impact (operational)           5.18.1 Object           5.18.2 Test procedure           5.18.3 Requirements           6 Marking and data           6.1 Marking           6.2 Documentation           6.2.1 General           6.2.2 Software documentation           6.2.1 General           6.2.2 Measuring bench           Annex B (normative) Bench for response threshold value measurements           A.1 Technical characteristics of the attenuators			
5.12.1 Object 5.12.2 Test procedure 5.12.3 Requirements 5.13.1 Damp heat, steady state (operational) 5.13.1 Object 5.13.2 Test procedure 5.13.3 Requirements 5.14.1 Damp heat, steady state (endurance) 5.14.1 Object 5.14.2 Test procedure 5.14.3 Requirements 5.14.3 Requirements 5.15.1 Vibration (endurance) 5.15.1 Object 5.15.2 Test procedure 5.15.3 Requirements 5.15.1 Ubjeat 5.15.1 Object 5.15.1 Object 5.15.2 Test procedure 5.15.3 Requirements 5.16 Electromagnetic compatibility (EMC), immunity tests (operational) 5.17 Sulphur dioxide SO2 corrosion (endurance) 5.17.1 Test procedure 5.17.1 Requirements 5.18 Impact (operational) 5.18.1 Object 5.18.2 Test procedure 5.18.3 Requirements 6.18 Impact (operational) 6.18 Object 6.18 Object 6.2 Software documentation 6.1 Marking and data 6.1 Marking and data 6.2 Documentation 6.2 Documentation 6.3 Arnex A (normative) Bench for response threshold value measurements 6.1 February (in the stream of the strea			
5.12.3 Requirements 5.13.1 Damp heat, steady state (operational) 5.13.1 Object 5.13.2 Test procedure 5.13.3 Requirements 5.14.1 Damp heat, steady state (endurance) 5.14.1 Object 5.14.2 Test procedure 5.14.3 Requirements 5.15.1 Vibration (endurance) 5.15.1 Vibration (endurance) 5.15.1 Vibration (endurance) 5.15.1 Object 5.15.2 Test procedure 5.15.3 Requirements 5.16 Electromagnetic compatibility (EMC), immunity tests (operational) 5.17.1 Object 5.17.2 Test procedure 5.17.3 Requirements 5.18 Impact (operational) 5.18 Impact (operational) 5.18.1 Object 5.18.2 Test procedure 5.18.3 Requirements 6 Marking and data 6.1 Marking and data 6.2 Software documentation 6.2.1 General 6.2.2 Software documentation 6.2.3 Marking and data 6.4 Marking and data 6.5 Marking and data 6.6 Marking and data 6.7 Marking and data 6.8 Marking and data 6.9 Marking and data 6.1 Technical characteristics of the attenuators 6 Marking and data 6.1 Technical characteristics of the attenuators 6 Marking and bench. 6 Mannex A (normative) Bench for response threshold value measurements 6 Marking bench. 6 Mannex B (normative) Smouldering pyrolysis wood fire (TF2) 6 Figure 1 Figure 1 Figure 2			
5.13. Requirements 5.13. Damp heat, steady state (operational) 5.13.1 Object 5.13.2 Test procedure 5.13.3 Requirements 5.14.1 Damp heat, steady state (endurance). 5.14.1 Object 5.14.2 Test procedure 5.14.3 Requirements 5.15. Vibration (endurance) 5.15.1 Object 5.15.1 Object 5.15.2 Test procedure 5.15.3 Requirements 5.16 Electromagnetic compatibility (EMC), immunity tests (operational). 5.17 Sulphur dioxide SO <sub>2</sub> corrosion (endurance). 5.17.1 Object 5.17.2 Test procedure 5.17.3 Requirements 5.18 Impact (operational). 5.18.1 Object 5.18.3 Requirements 5.18.1 Object 6.2 Doscomentation 6.2 Documentation 6.2 Documentation 6.2 Software documentation 6.2 General. 6.1 Technical characteristics of the attenuators 6.2 Marking and data 6.1 Technical characteristics of the attenuators 6.2 Measuring bench. 6.3 Annex A (normative) Bench for response threshold value measurements 6.1 Full Measuring bench. 6.2 Measuring bench. 6.3 Annex C (normative) Smouldering pyrolysis wood fire (TF2) 6.1 Fuel . 6.2 Hotplate . 6.3 Arrangement 6.4 Heating rate 6.5 End of test condition			
5.13.1 Object. 5.13.2 Test procedure 5.13.3 Requirements. 5.14.1 Object. 5.14.1 Object. 5.14.2 Test procedure 5.14.3 Requirements. 5.14.3 Requirements. 5.14.4 Requirements. 5.15.1 Vibration (endurance). 5.15.1 Object. 5.15.2 Test procedure 5.15.3 Requirements. 5.15 Vibration (endurance). 5.15.1 Object. 5.15.3 Requirements. 5.16 Electromagnetic compatibility (EMC), immunity tests (operational). 5.17 Sulphur dioxide SO <sub>2</sub> corrosion (endurance). 5.17.1 Object. 5.17.2 Test procedure. 5.17.3 Requirements. 5.18 Impact (operational). 5.18.1 Object. 5.18.2 Test procedure. 5.18.3 Requirements. 6 Marking and data . 6.1 Marking and data . 6.2 Documentation . 6.2.1 General . 6.2.2 Software documentation . Annex A (normative) Bench for response threshold value measurements . A.1 Technical characteristics of the attenuators. A.2 Measuring bench . Annex B (normative) Fire test room . Annex C (normative) Smouldering pyrolysis wood fire (TF2) . C.1 Fuel . C.2 Hotplate . C.3 Arrangement . C.4 Heating rate .			
5.13.1 Object 5.13.2 Test procedure 5.13.3 Requirements 5.14.1 Damp heat, steady state (endurance) 5.14.1 Object 5.14.3 Requirements 5.15.1 Object 5.15.1 Object 5.15.2 Test procedure 5.15.3 Requirements 5.15.1 Object 5.15.2 Test procedure 5.15.3 Requirements 5.16 Electromagnetic compatibility (EMC), immunity tests (operational) 5.17 Sulphur dioxide SO <sub>2</sub> corrosion (endurance) 5.17.2 Test procedure 5.17.3 Requirements 5.18.1 Object 5.17.3 Requirements 5.18.1 Requirements 5.18.1 Requirements 5.18.1 Requirements 6.18.1 Object 6.18.2 Test procedure 6.18.3 Requirements 6.4 Marking and data 6.5 Marking and data 6.1 Marking 6.2 Documentation 6.2.1 General 6.2.2 Software documentation Annex A (normative) Bench for response threshold value measurements A.1 Technical characteristics of the attenuators A.2 Measuring bench Annex B (normative) Fire test room Annex C (normative) Smouldering pyrolysis wood fire (TF2) C.1 Fuel C.2 Hotplate C.3 Arrangement C.4 Heating rate C.4 Heating rate C.5 End of test condition			
5.13.2 Test procedure 5.14. Damp heat, steady state (endurance). 5.14.1 Object 5.14.2 Test procedure 5.14.3 Requirements. 5.15. Vibration (endurance). 5.15.1 Object 5.15.2 Test procedure 5.15.3 Requirements 5.16 Electromagnetic compatibility (EMC), immunity tests (operational). 5.17 Sulphur dioxide SO <sub>2</sub> corrosion (endurance). 5.17.1 Object 5.17.2 Test procedure 5.18.1 Impact (operational). 5.18.1 Object 5.18.3 Requirements 6.4 Marking and data 6.1 Marking and data 6.2 Documentation 6.2.1 General 6.2.2 Software documentation Annex A (normative) Bench for response threshold value measurements A.1 Technical characteristics of the attenuators. Anex B (normative) Fire test room Annex C (normative) Fire test room Annex C (normative) Smouldering pyrolysis wood fire (TF2) C.1 Fuel C.2 Hotplate C.3 Arrangement C.4 Heating rate End of test condition		Damp fleat, Steady State (operational)	∠ა
5.13.3 Requirements 5.14.1 Object 5.14.2 Test procedure 5.14.3 Requirements 5.15. Vibration (endurance) 5.15.1 Object 5.15.1 Object 5.15.1 Object 5.15.2 Test procedure 5.16.3 Requirements 5.16 Electromagnetic compatibility (EMC), immunity tests (operational) 5.17 Sulphur dioxide SO <sub>2</sub> corrosion (endurance) 5.17.1 Object 5.17.2 Test procedure 5.17.3 Requirements 5.18 Impact (operational) 5.18 Impact (operational) 5.18 Object 5.18.2 Test procedure 5.18.3 Requirements 6 Marking and data 6.1 Marking 6.2 Documentation 6.2.1 General 6.2.2 Software documentation Annex A (normative) Bench for response threshold value measurements A.1 Technical characteristics of the attenuators A.2 Measuring bench Annex B (normative) Fire test room Annex C (normative) Smouldering pyrolysis wood fire (TF2) C.1 Fuel C.2 Hotplate C.3 Arrangement C.4 Heating rate End of test condition			
5.14 Damp heat, steady state (endurance) 5.14.1 Object			
5.14.1 Object 5.14.3 Requirements 5.15 Vibration (endurance) 5.15.1 Object 5.15.3 Requirements 5.16 Electromagnetic compatibility (EMC), immunity tests (operational). 5.17 Sulphur dioxide SO <sub>2</sub> corrosion (endurance). 5.17.1 Object 5.17.2 Test procedure. 5.17.3 Requirements 5.18 Impact (operational). 5.18 Impact (operational). 5.18.1 Object 5.18.1 Object 5.18.2 Test procedure. 5.18.3 Requirements 6.18 Arking and data 6.1 Marking and data 6.2 Documentation 6.2.1 General. 6.2.2 Software documentation Annex A (normative) Bench for response threshold value measurements A.1 Technical characteristics of the attenuators A.2 Measuring bench Annex B (normative) Fire test room Annex C (normative) Smouldering pyrolysis wood fire (TF2). C.1 Fuel C.2 Hotplate C.3 Arrangement C.4 Heating rate C.5 End of test condition			
5.14.2 Test procedure 5.14.3 Requirements 5.15. Vibration (endurance). 5.15.1 Object 5.15.2 Test procedure 5.15.3 Requirements 5.16 Electromagnetic compatibility (EMC), immunity tests (operational). 5.17 Sulphur dioxide SO <sub>2</sub> corrosion (endurance). 5.17.1 Object 5.17.2 Test procedure 5.17.3 Requirements 5.18 Impact (operational). 5.18.1 Object 5.18.2 Test procedure 5.18.3 Requirements 6.1 Marking and data 6.1 Marking. 6.2 Documentation 6.2 Documentation 6.2.1 General 6.2.2 Software documentation Annex A (normative) Bench for response threshold value measurements A.1 Technical characteristics of the attenuators A.2 Measuring bench Annex B (normative) Fire test room Annex B (normative) Fire test room Annex B (normative) Fire test room Annex C (normative) Smouldering pyrolysis wood fire (TF2) C.1 Fuel C.2 Hotplate C.3 Arrangement C.4 Heating rate C.5 End of test condition		Object	24
5.14.3 Requirements 5.15 Vibration (endurance) 5.15.1 Object 5.15.2 Test procedure 5.15.3 Requirements 5.16 Electromagnetic compatibility (EMC), immunity tests (operational) 5.17 Sulphur dioxide SO <sub>2</sub> corrosion (endurance) 5.17.1 Object 5.17.2 Test procedure 5.17.3 Requirements 5.18 Impact (operational) 5.18.1 Object 5.18.1 Object 5.18.2 Test procedure 5.18.3 Requirements 6. Marking and data 6.1 Marking and data 6.1 Marking 4. 6.2 Documentation 6.2.2 Software documentation Annex A (normative) Bench for response threshold value measurements A.1 Technical characteristics of the attenuators A.2 Measuring bench Annex B (normative) Fire test room Annex C (normative) Smouldering pyrolysis wood fire (TF2) C.1 Fuel C.2 Hotplate C.3 Arrangement C.4 Heating rate C.5 End of test condition			
5.15 Vibration (endurance) 5.15.1 Object 5.15.2 Test procedure 5.15.3 Requirements 5.16 Electromagnetic compatibility (EMC), immunity tests (operational) 5.17 Sulphur dioxide SO <sub>2</sub> corrosion (endurance) 5.17.1 Object 5.17.2 Test procedure 5.17.3 Requirements 5.18 Impact (operational) 5.18.1 Object 5.18.1 Object 5.18.2 Test procedure 5.18.3 Requirements 6 Marking and data 6.1 Marking 6.2 Documentation 6.2.1 General 6.2.2 Software documentation Annex A (normative) Bench for response threshold value measurements A.1 Technical characteristics of the attenuators A.2 Measuring bench Annex B (normative) Fire test room Annex B (normative) Smouldering pyrolysis wood fire (TF2) C.1 Fuel C.2 Hotplate C.3 Arrangement C.4 Heating rate C.5 End of test condition			
5.15.1 Object 5.15.2 Test procedure 5.15.3 Requirements 5.16 Electromagnetic compatibility (EMC), immunity tests (operational). 5.17 Sulphur dioxide SO <sub>2</sub> corrosion (endurance). 5.17.1 Object 5.17.2 Test procedure 5.17.3 Requirements 5.18 Impact (operational) 5.18.1 Object 5.18.2 Test procedure 5.18.3 Requirements 6 Marking and data 6.1 Marking 6.2 Documentation 6.2.1 General 6.2.2 Software documentation 6.2.3 Oftware documentation 6.4 (normative) Bench for response threshold value measurements 6.1 Technical characteristics of the attenuators 6.2 Measuring bench 6.1 Mensury Brize test room 6.2 Mensury Brize test room 6.2 Mensury Brize test room 6.3 Mensury Brize test room 6.4 Mensury Brize test room 6.5 Mensury Brize test room 6.6 Marking Brize test room 6.7 Measuring bench 6.8 Mensury Brize test room 6.9 Mensury Brize test room 6.1 Mensury Brize test room 6.1 Mensury Brize test room 6.2 Mensury Brize test room 6.3 Arrangement 6.4 Heating rate 6.5 End of test condition		Vibration (andurance)	25
5.15.2 Test procedure 5.15.3 Requirements 5.16 Electromagnetic compatibility (EMC), immunity tests (operational). 5.17 Sulphur dioxide SO <sub>2</sub> corrosion (endurance). 5.17.1 Object. 5.17.2 Test procedure 5.17.3 Requirements 5.18 Impact (operational). 5.18.1 Object. 5.18.2 Test procedure. 5.18.3 Requirements. 6 Marking and data 6.1 Marking. 6.2 Documentation 6.2.1 General 6.2.2 Software documentation Annex A (normative) Bench for response threshold value measurements A.1 Technical characteristics of the attenuators Anex B (normative) Fire test room Annex C (normative) Smouldering pyrolysis wood fire (TF2). C.1 Fuel C.2 Hotplate C.3 Arrangement C.4 Heating rate C.5 End of test condition			
5.15.3 Requirements 5.16 Electromagnetic compatibility (EMC), immunity tests (operational). 5.17 Sulphur dioxide SO <sub>2</sub> corrosion (endurance). 5.17.1 Object. 5.17.2 Test procedure. 5.17.3 Requirements. 5.18 Impact (operational). 5.18.1 Object. 5.18.2 Test procedure. 5.18.3 Requirements. 6 Marking and data. 6.1 Marking. 6.2 Documentation. 6.2.1 General. 6.2.2 Software documentation. Annex A (normative) Bench for response threshold value measurements. A.1 Technical characteristics of the attenuators. Annex B (normative) Fire test room. Annex C (normative) Smouldering pyrolysis wood fire (TF2). C.1 Fuel. C.2 Hotplate. C.3 Arrangement. C.4 Heating rate. C.5 End of test condition.			
5.16 Electromagnetic compatibility (EMC), immunity tests (operational) 5.17 Sulphur dioxide SO <sub>2</sub> corrosion (endurance) 5.17.1 Object 5.17.2 Test procedure 5.17.3 Requirements 5.18 Impact (operational) 5.18.1 Object 5.18.2 Test procedure 5.18.3 Requirements 6. Marking and data 6.1 Marking and data 6.2 Documentation 6.2.1 General 6.2.2 Software documentation Annex A (normative) Bench for response threshold value measurements A.1 Technical characteristics of the attenuators A.2 Measuring bench Annex B (normative) Fire test room Annex C (normative) Smouldering pyrolysis wood fire (TF2) C.1 Fuel C.2 Hotplate C.3 Arrangement C.4 Heating rate C.5 End of test condition			
5.17 Sulphur dioxide SO <sub>2</sub> corrosion (endurance). 5.17.1 Object			
5.17.1 Object 5.17.2 Test procedure 5.17.3 Requirements 5.18 Impact (operational) 5.18.1 Object 5.18.2 Test procedure 5.18.3 Requirements 6 Marking and data 6.1 Marking 6.2 Documentation 6.2.1 General 6.2.2 Software documentation Annex A (normative) Bench for response threshold value measurements A.1 Technical characteristics of the attenuators A.2 Measuring bench Annex B (normative) Fire test room Annex C (normative) Smouldering pyrolysis wood fire (TF2) C.1 Fuel C.2 Hotplate C.3 Arrangement C.4 Heating rate C.5 End of test condition	-		
5.17.2 Test procedure 5.17.3 Requirements 5.18 Impact (operational) 5.18.1 Object 5.18.2 Test procedure 5.18.3 Requirements 6 Marking and data 6.1 Marking 6.2 Documentation 6.2.1 General 6.2.2 Software documentation 6.2.3 Software documentation 6.1 Technical characteristics of the attenuators 6.2 Measuring bench 6.1 Test or omative) Fire test room 6.2 Mennex B (normative) Fire test room 6.2 Mennex C (normative) Smouldering pyrolysis wood fire (TF2) 6.1 Fuel 6.2 Hotplate 6.3 Arrangement 6.4 Heating rate 6.5 End of test condition	-		
5.17.3 Requirements 5.18 Impact (operational) 5.18.1 Object 5.18.2 Test procedure 5.18.3 Requirements 6 Marking and data 6.1 Marking 6.2 Documentation 6.2.1 General 6.2.2 Software documentation 6.2.3 Software documentation 6.1 Technical characteristics of the attenuators 6.2 Measuring bench 6.3 Measuring bench 6.4 Technical characteristics of the attenuators 6.5 Tevel 6.6 Marking 6.7 Documentation 6.8 Marking 6.9 Documentation 6.9 Documentation 6.1 Marking 6.1 Marking 6.2 Documentation 6.2 Normative) Bench for response threshold value measurements 6.1 Technical characteristics of the attenuators 6.2 Measuring bench 6.3 Marking 6.4 Hotplate 6.5 End of test condition			
5.18 Impact (operational) 5.18.1 Object 5.18.2 Test procedure 5.18.3 Requirements 6 Marking and data 6.1 Marking 6.2 Documentation 6.2.1 General 6.2.2 Software documentation Annex A (normative) Bench for response threshold value measurements A.1 Technical characteristics of the attenuators A.2 Measuring bench Annex B (normative) Fire test room Annex C (normative) Smouldering pyrolysis wood fire (TF2) C.1 Fuel C.2 Hotplate C.3 Arrangement C.4 Heating rate C.5 End of test condition			
5.18.1 Object			
5.18.2 Test procedure		Object	28
5.18.3 Requirements 6 Marking and data 6.1 Marking 6.2 Documentation 6.2.1 General 6.2.2 Software documentation Annex A (normative) Bench for response threshold value measurements A.1 Technical characteristics of the attenuators A.2 Measuring bench Annex B (normative) Fire test room Annex C (normative) Smouldering pyrolysis wood fire (TF2) C.1 Fuel C.2 Hotplate C.3 Arrangement C.4 Heating rate C.5 End of test condition	5.18.2	Test procedure	28
6 Marking and data 6.1 Marking 6.2 Documentation 6.2.1 General 6.2.2 Software documentation Annex A (normative) Bench for response threshold value measurements A.1 Technical characteristics of the attenuators A.2 Measuring bench Annex B (normative) Fire test room Annex C (normative) Smouldering pyrolysis wood fire (TF2) C.1 Fuel C.2 Hotplate C.3 Arrangement C.4 Heating rate C.5 End of test condition			28
6.1 Marking 6.2 Documentation 6.2.1 General 6.2.2 Software documentation  Annex A (normative) Bench for response threshold value measurements  A.1 Technical characteristics of the attenuators  A.2 Measuring bench  Annex B (normative) Fire test room  Annex C (normative) Smouldering pyrolysis wood fire (TF2)  C.1 Fuel  C.2 Hotplate  C.3 Arrangement  C.4 Heating rate  C.5 End of test condition			29
6.2 Documentation 6.2.1 General	-		29
6.2.1 General	6.2		
6.2.2 Software documentation  Annex A (normative) Bench for response threshold value measurements  A.1 Technical characteristics of the attenuators  A.2 Measuring bench  Annex B (normative) Fire test room  Annex C (normative) Smouldering pyrolysis wood fire (TF2)  C.1 Fuel  C.2 Hotplate  C.3 Arrangement  C.4 Heating rate  C.5 End of test condition	6.2.1	General	
Annex A (normative) Bench for response threshold value measurements  A.1 Technical characteristics of the attenuators	-		30
A.1 Technical characteristics of the attenuators  A.2 Measuring bench			
A.2 Measuring bench  Annex B (normative) Fire test room  Annex C (normative) Smouldering pyrolysis wood fire (TF2)  C.1 Fuel  C.2 Hotplate  C.3 Arrangement  C.4 Heating rate  C.5 End of test condition			31
Annex B (normative) Fire test room  Annex C (normative) Smouldering pyrolysis wood fire (TF2)  C.1 Fuel  C.2 Hotplate  C.3 Arrangement  C.4 Heating rate  C.5 End of test condition			
Annex C (normative) Smouldering pyrolysis wood fire (TF2)  C.1 Fuel  C.2 Hotplate  C.3 Arrangement  C.4 Heating rate  C.5 End of test condition			
C.1 Fuel			
C.2 Hotplate			
C.3 Arrangement	_		
C.4 Heating rate	-		
C.5 End of test condition		Heating rate	35
	-		35
	C.6		35

Annex	D (normative) Glowing smouldering cotton fire (TF3)	37
D.1	Fuel	
D.2	Arrangement	
D.3	Ignition	38
D.4	End of test condition	38
D.5	Test validity criteria	38
Annex	E (normative) Flaming plastics (polyurethane) fire (TF4)	39
E.1	Fuel	39
E.2	Arrangement	39
E.3	Ignition	39
E.4	End of test condition	
E.5	Test validity criteria	40
Annex	F (normative) Flaming liquid (n-heptane) fire (TF5)	41
F.1	Fuel	41
F.2	ArrangementIgnition	41
F.3	Ignition	41
F.4	End of test condition	41
F.5	Test validity criteria	41
Annex	G (normative) Apparatus for stray light	43
G.1	Installation	
G.2	The light source	45
Annex	ZA (informative) Clauses of this European Standard addressing essential requirements or	ſ
	provisions of EU Directives	
Bibliog	raphy	52

#### **Foreword**

This document EN 54-12:2002 has been prepared by Technical Committee CEN/TC 72 "Fire detection and fire alarm systems", the secretariat of which is held by BSI.

This European Standard shall be given the status of a national standard, either by publication of an identical text or by endorsement, at the latest by May 2003, and conflicting national standards shall be withdrawn at the latest by November 2005.

This document has been prepared under a mandate given to CEN by the European Commission and the European Free Trade Association, and supports essential requirements of EU Directive(s).

For relationship with EU Directive(s), see informative Annex ZA, which is an integral part of this document.

This standard has been prepared in cooperation with the CEA (Comité Européen des Assurances) and with EURALARM (Association of European Manufacturers of Fire and Intruder Alarm Systems).

Information on the relationship between this European Standard and other standards of the EN 54 series is given in annex A of EN 54-1:1996.

In this European Standard the annexes A to G are normative.

This document includes a Bibliography.

According to the CEN/CENELEC Internal Regulations, the national standards organizations of the following countries are bound to implement this European Standard: Austria, Belgium, Czech Republic, Denmark, Finland, France, Germany, Greece, Iceland, Ireland, Italy, Luxembourg, Malta, Netherlands, Norway, Portugal, Spain, Sweden, Switzerland and the United Kingdom.



This European Standard specifies requirements, test methods and performance criteria for line smoke detectors utilising the attenuation and/or changes in attenuation of an optical beam, for use in fire detection systems installed in buildings.

This European Standard does not cover:

Line smoke detectors designed to operate with separations between opposed components of less than 1 m; Line smoke detectors whose optical path length is defined or adjusted by an integral mechanical connection;

Line smoke detectors with special characteristics, which cannot be assessed by the test methods in this European Standard.

NOTE The term "optical" is used to describe that part of the electromagnetic spectrum produced by the transmitter to which the receiver is responsive; this is not restricted to visible wavelengths.

#### 2 Normative references

This European Standard incorporates by dated or undated reference, provisions from other publications. These normative references are cited at the appropriate places in the text, and the publications are listed hereafter. For dated references, subsequent amendments to or revisions of any of these publications apply to this European Standard only when incorporated in it by amendment or revision. For undated references the latest edition of the publication referred to applies (including amendments).

EN 54-1	1996	Fire detection and fire alarm systems - Part 1: Introduction.  Fire detection and fire alarm systems - Part 7: Smoke detectors -
EN 54-7		Point
		detectors using scattered light, transmitted light or ionization.
		Alarm systems - Part 4: Electromagnetic compatibility - Product
EN 50130-4	1995	family
		standard: Immunity requirements for components of fire, intruder and social
		alarm systems.
		Tungsten filament lamps for domestic and similar general lighting
EN 60064		purposes.
211 00001		Performance requirements (IEC 60064:1993, modified).
		Environmental testing - Part 1: General and guidance (IEC 60068-
EN 60068-1		1:1988 +
		Corrigendum 1988 + A1:1992).
		Environmental testing - Part 2: Tests - Test A: Cold (IEC 60068-2-
EN 60068-2-1	1993	1:1990).
EN 00000 0 0	4000	Basic environmental testing procedures - Part 2: Tests - Test B: dry
EN 60068-2-2	1993	hěat (IEC 60060 2 2:4074 : IEC 60 2 24:4076)
		(IEC 60068-2-2:1974 + IEC 68-2-2A:1976). Environmental testing – Part 2: Tests - Test Fc: Vibration, (sinusoidal)
EN 60068-2-6	1995	(IEC
214 00000 2 0	1000	60068-2-6:1995 + Corrigendum 1995).
EN 60068-2-		Environmental testing - Part 2: Tests – Test Eh: Hammer tests (IEC
75		60068-2-
		75:1997).
		Double-capped fluorescent lamps - Performance specifications
EN 60081		(IEC
		60081:1997).
		Basic environmental testing procedures - Part 2: tests; test Ca: damp
HD 323.2.3 S2		heat,
		steady state.

HD 323.2.56 S1	1990	Basic environmental testing procedures - Part 2: Tests - Test Cb: Damp heat, steady state, primarily for equipment.
IEC 60068-2- 42	1982	Basic environmental testing procedures - Part 2: Tests - Test Kc: Sulphur
		dioxide test for contacts and connections.



#### 3 Terms and definitions

For the purposes of this European Standard the terms and definitions given in EN 54-1:1996 and the following apply.

#### 3.1

#### line smoke detector using an optical beam

detector consisting at least of a transmitter and a receiver and which may include reflector(s) for the detection of smoke by the attenuation and/or changes in attenuation of an optical beam

#### 3.2

#### transmitter

component from which the optical beam emanates

#### 3.3

#### receiver

component which receives the optical beam

#### 3.4

#### optical path length

total distance traversed by the optical beam between the transmitter and the receiver

#### 3.5

#### opposed component

component [transmitter and receiver or transmitter-receiver and reflector(s)] of the beam detector whose position determines the optical path

#### 3.6

#### separation

physical distance between the opposed components [transmitter and receiver or transmitter-receiver and reflector(s)]

#### 3.7

#### attenuation

value "C", expressed in dB, of the reduction in intensity of the optical beam at the receiver, defined by the following equation:

 $C = 10 \log 10 (10/1)$ 

#### where

10 is the received intensity without reduction in intensity;

*I* is the received intensity after reduction in intensity.

#### 3.8

#### response threshold value

value of attenuation at the moment an alarm signal is generated by a specimen, when tested in accordance with 5.1.5

#### 3.9

#### sensitivity adjustment

any adjustment during or after commissioning which leads to a change in the response to fire

#### 4 Requirements

#### 4.1 Compliance

In order to comply with this standard the detector shall meet the requirements of this clause, which shall be verified by visual inspection or engineering assessment, shall be tested in accordance with clause 5 and shall meet the requirements of the tests.

#### 4.2 Individual alarm indication

Each detector shall be provided with an integral red visible indicator, by means of which each individual detector which releases an alarm can be identified, until the alarm condition is reset.

#### 4.3 Connection of ancillary devices

If the detector provides for connections to ancillary devices (e.g. remote indicators, control relays), open or short-circuit failures of these connections shall not prevent the correct operation of the detector.

#### 4.4 Manufacturer's adjustments

It shall not be possible to change the manufacturer's settings except by special means (e.g. the use of a special code or tool, or by breaking or removing a seal).

#### 4.5 On-site adjustment of response threshold value

If there is provision for on-site adjustment of the response threshold value of the detector then:

- a) For each setting, at which the manufacturer claims compliance with this standard, the detector shall comply with the requirements of this standard, and access to the adjustment means shall only be possible by the use of a code or special tool or by removing the detector from its base or mounting;
- b) any setting(s), at which the manufacturer does not claim compliance with this standard, shall only be accessible by the use of a code or special tool, and it shall be clearly marked on the detector or in the associated data, that if these setting(s) are used, the detector does not comply with this standard.

NOTE These adjustments may be carried out at the detector or at the control and indicating equipment, for example.

#### 4.6 Protection against ingress of foreign bodies

The detector shall be designed so that a sphere of diameter  $(1,3 \pm 0,05)$  mm cannot pass into any enclosure containing active opto-electronic components, when the detector is in operational condition.

#### 4.7 Monitoring of detachable detectors and connections

For detachable detectors, a means shall be provided for a remote monitoring system (e.g. the control and indicating equipment) to detect the removal of the head from the base, in order to give a fault signal.

If there are cables connecting separate parts of the detector, then a means shall be provided for a remote monitoring system (e.g. the control and indicating equipment) to detect a short or open circuit on those cables, in order to give a fault signal.

#### 4.8 Limit of compensation

The detector shall emit either a fault or alarm signal at the limit of compensation for the effect of a slowly changing response (signal).

Since it is practically impossible to perform tests with very slight increases in smoke density, an evaluation of the detector's conformity shall be made by analysing the circuits/software and/or by physical tests and simulations.

#### 4.9 Additional requirements for software controlled detectors

#### 4.9.1 General

For detectors which rely on software control in order to fulfil the requirements of this standard, the requirements of 4.9.2 and 4.9.3 shall be met.

#### 4.9.2 Software design

In order to ensure the reliability of the detector, the following requirements for software design shall apply:

- a) the software shall have a modular structure;
- b) the design of the interfaces for manually and automatically generated data shall not permit invalid data to cause error in the program operation;
- c) the software shall be designed to avoid the occurrence of deadlock of the program flow.

#### 4.9.3 The storage of programs and data

The program necessary to comply with this standard and any preset data, such as manufacturer's settings, shall be held in non-volatile memory. Writing to areas of memory containing this program and data shall only be possible by the use of some special tool or code and shall not be possible during normal operation of the detector.

Site-specific data shall be held in memory which will retain data for at least two weeks without external power to the detector, unless provision is made for the automatic renewal of such data, following loss of power, within 1 h of power being restored.

#### 4.10 Fault signalling

A fire alarm signal shall not be cancelled by a fault resulting from a rapid change in obscuration (in accordance with 5.6) or by a result of the limit of compensation being reached (in accordance with 4.8).

#### 5 Test methods

#### 5.1 General

#### 5.1.1 Atmospheric conditions for tests

Unless otherwise stated in a test procedure, the testing shall be carried out after the test specimen has been allowed to stabilize in the standard atmospheric conditions for testing as described in EN 60068-1 as follows:

```
temperature: 15 °C to 35 °C;
humidity: 25 % to 75 %;
air pressure: 86 kPa to 106 kPa.
```

NOTE If variations in these parameters have a significant effect on a measurement, then such variations should be kept to a minimum during a series of measurements carried out as part of one test on one specimen.

#### 5.1.2 Operating conditions for tests

If a test method requires a specimen to be operational, the specimen shall be connected to suitable supply and monitoring equipment with characteristics as required by the manufacturer's data. Unless otherwise specified in the test method, the supply parameters applied to the specimen shall be set within the manufacturer's specified range(s) and shall remain substantially constant throughout the tests. The value chosen for each parameter shall normally be the nominal value, or the mean of the specified range.

If a test procedure requires a specimen to be monitored to detect any alarm or fault signals, then connections shall be made to any necessary ancillary devices (e.g. through wiring to an end-of-line device for conventional detectors) to allow a fault signal to be recognised.

The details of the supply and monitoring equipment and the alarm criteria used shall be given in the test report.

#### 5.1.3 Mounting arrangements

The specimen shall be mounted by its normal means of attachment and aligned in accordance with the manufacturer's instructions. If these instructions describe more than one method of mounting, the method considered to be most unfavourable shall be chosen for each test.

#### 5.1.4 Tolerances

Unless otherwise stated, the tolerances for the environmental test parameters shall be as given in the basic reference standards for the test (e.g. the relevant Part of IEC/EN 60068).

If a requirement or a test procedure does not specify a tolerance or deviation limits, deviation limits of  $\pm$  5 % shall be applied.

#### 5.1.5 Measurement of response threshold value

#### 5.1.5.1 General

The specimen, for which the response threshold value is to be measured, shall be installed on the measuring bench, conforming to annex A, in its normal operating position, by its normal means of attachment in accordance with 5.1.3.

The specimen shall be connected to its supply and monitoring equipment in accordance with 5.1.2, and shall be allowed to stabilize for at least 15 min.

The response threshold value shall be recorded as *C*.

#### 5.1.5.2 Operating conditions

On a rigid support assemble the receiver at a longitudinal distance of at least 500 mm from the transmitter or the transmitter - receiver at the same distance from the reflector (see Figure A.1), then place a filter holder as close as possible to the front of the receiver, adjusting the filter holder so that the whole beam passes through the filter. This filter holder shall be used to mount the filters used during the measurement of response threshold value.

The height *h* separating the axis of the optical beam above the support shall be 10 times the diameter (or the vertical dimension) of the optical system of the receiver.

Adjustment for path length or alignment, if required, shall be carried out in accordance with the manufacturer's instructions.

Unless otherwise stated in a test procedure, the response threshold value shall be measured with a simulated maximum separation carried out using means agreed by the manufacturer.

#### 5.1.5.3 Measurements

The response threshold value is determined by the value of the lowest value test filter required to give an alarm within 30 s after introduction in the beam. The minimum resolution for optical density filters shall be in accordance with Table A.1 (see annex A).

#### 5.1.6 Provision for tests

The following shall be provided for testing compliance with this standard:

- a) seven detectors;
- b) the documentation required in 6.2.

The specimens submitted shall be representative of the manufacturer's normal production with regard to their construction and calibration.

NOTE This implies that the mean response threshold value of the seven specimens, found in the reproducibility test should also represent the production mean, and that the limits specified in the reproducibility test should also be applicable to the manufacturer's production.

#### 5.1.7 Test schedule

The specimens shall be tested in accordance with the test schedule in Table 1. After the reproducibility test, the two least sensitive specimens (i.e. those with the highest response thresholds) shall be numbered 6 and 7, and the others shall be numbered 1 to 5.

Table 1 — Test Schedule

Test	Clause	Specimen N°(s)
Reproducibility	5.2	all specimens
Repeatability	5.3	2
Directional dependence	5.4	
Rapid changes in obscuration	5.6	1
Slow changes in obscuration	5.7	1
Optical path length dependence	5.8	1
Fire sensitivity	<b>5</b> .9	6 and 7
Stray light	5.10	6
Dry heat (operational)	5.11	3
Cold (operational)	5.12	3
Damp heat, steady state (operational)	5.13	2
Damp heat, steady state (endurance)	5.14	2
Vibration (endurance)	5.15	7
Electrostatic discharge (operational)	5.16	4 <sup>a</sup>
Radiated electromagnetic fields (operational)	5.16	6 <sup>a</sup>
Conducted disturbances induced by electromagnetic fields (operational)	5.16	6 a
Fast transient bursts (operational)	5.16	4 <sup>a</sup>
Slow high energy voltage surges (operational)	5.16	6 <sup>a</sup>
Sulphur dioxide SO2 corrosion (endurance)	5.17	5
Impact (operational)	5.18	1

<sup>&</sup>lt;sup>a</sup> In the interests of test economy, it is permitted to use the same specimen for more than one EMC test. In that case, intermediate functional test(s) on the specimen(s) used for more than one test may be deleted, and the functional test conducted at the end of the sequence of tests. However it should be noted that in the event of a failure, it may not be possible to identify which test exposure caused the failure (see clause 4 of EN 50130-4:1995).

#### 5.2 Reproducibility

#### 5.2.1 Object

The detector is tested to show that the sensitivity does not vary unduly from specimen to specimen.

#### 5.2.2 Test procedure

Adjust the specimens to the maximum sensitivity.

Measure the response threshold value of each of the specimens in accordance with 5.1.5.

The mean of these response threshold values shall be calculated and shall be designated Crep.

The maximum response threshold value shall be designated  $C_{\max}$  and the minimum value shall be designated  $C_{\min}$ .

#### 5.2.3 Requirements

Cmin shall not be less than 0,4 dB.

The ratio of the response threshold values  $C_{\text{max}}$ :  $C_{\text{rep}}$  shall not be greater than 1,33, and the ratio of the response threshold values  $C_{\text{rep}}$ :  $C_{\text{min}}$  shall not be greater than 1,5.

#### 5.3Repeatability

#### 5.3.1 Object

The detector is tested to show that it has stable behaviour with respect to its sensitivity even after a number of alarm conditions.

#### 5.3.2 Test procedure

Adjust the specimen to the maximum sensitivity.

Measure the response threshold value of the specimen three times in accordance with 5.1.5.

The period between successive determinations shall not be less than 15 min or more than 1 h.

The specimen is then powered without interruption or disturbance to the optical beam for 7 days. Again measure the response threshold value of the specimen in accordance with 5.1.5, once.

The maximum response threshold value shall be designated  $C_{\max}$  and the minimum value shall be designated  $C_{\min}$ .

#### 5.3.3 Requirements

No alarm or fault signals shall be emitted during the 7 days between testing.

Cmin shall not be less than 0,4 dB.

The ratio of the response threshold values Cmax: Cmin shall not be greater than 1,6.

#### 5.4 Directional dependence

#### 5.4.1 Object

The detector is tested to show that small angular inaccuracies in alignment (within the maximum stated by the manufacturer), resulting from installation and/or movement in the structure of a building do not affect the operation of the detector.

#### 5.4.2 Test procedure

#### 5.4.2.1 State of the specimen during conditioning

Adjust the specimen to the maximum sensitivity, and mount in accordance with 5.1.3 with the maximum separation. Connect in accordance with 5.1.2.

With the agreement of the manufacturer this test may be carried out outside of the limits of atmospheric conditions of 5.1.1.

#### 5.4.2.2 Conditioning

Subject each opposed component to the following procedures whilst holding the other component stationary.

a) Rotate the component in a clockwise direction about a vertical axis at a rate of  $(0.3 \pm 0.05)^{\circ}$  min<sup>-1</sup> up to the maximum angular misalignment declared by the manufacturer in accordance with 6.2. After 2 min in this position, place an attenuator of value 6 dB in the optical path.

Remove the attenuator and reset the detector.

Return the rotated component to its original position, reset the detector and allow it to stabilize;

- b) Repeat the procedure described in a) but rotate the component in a counter-clockwise direction;
- c) Repeat the procedures described in a) and b) but rotate the component about a horizontal axis normal to the beam.

#### 5.4.3 Requirements

The specimen shall not emit a fault or an alarm signal whilst being rotated in the directions specified within the angular tolerances stated by the manufacturer (see 6.2a)).

The specimen shall emit an alarm signal no more than 30 s after the total introduction of the attenuator specified in 5.4.2.2.

#### 5.5 Variation of supply parameters

#### 5.5.1 Object

The detector is tested to show that, within the specified range(s) of the supply parameters (e.g. voltage), its sensitivity is not unduly dependent on these parameters.

#### 5.5.2 Test procedure

Adjust the specimen to the maximum sensitivity.

Measure the response threshold value of the specimen in accordance with 5.1.5 under the extremes of the specified conditions (e.g. minimum and maximum voltage).

The maximum response threshold value shall be designated Cmax and the minimum value shall be designated

 $C_{\min}$ 

NOTE For conventional detectors the supply parameter is the dc voltage applied to the detector. For other types of detector (e.g. analogue addressable) signal levels and timing may need to be considered. If necessary the manufacturer may be requested to provide suitable supply equipment to allow the supply parameters to be changed as required.

#### 5.5.3 Requirements

Cmin shall not be less than 0,4 dB.

The ratio of the response threshold values Cmax: Cmin shall not be greater than 1,6.

#### 5.6 Rapid changes in attenuation

#### 5.6.1 **Object**

The detector is tested to ensure that it will produce alarm or fault signals, within an acceptable time, after a sudden large sustained increase in beam attenuation.

#### 5.6.2 Test procedure

Adjust the specimen to the minimum sensitivity, and mount and connect in accordance with 5.1.5.

The following attenuators shall be used:

attenuator A: value 6 dB;

+3

attenuator B: value 10 () dB.

Place the attenuator A in the optical path. The time to reach maximum obscuration shall not be greater than 1 s. Keep the attenuator A in place for 40 s.

Remove attenuator A, reset the detector and place the attenuator B in the optical path. The time to reach maximum obscuration shall not be greater than 1 s. Keep the attenuator B in place for 70 s

#### 5.6.3 Requirements

The specimen shall emit an alarm signal no more than 30 s after the total introduction of the attenuator A between the components.

The specimen shall emit a fault or alarm signal no more than 60 s after the total introduction of the attenuator B between the components.

#### 5.7 Slow changes in attenuation

#### **5.7.1** Object

The detector is tested to ensure that it can detect a slowly developing fire, despite the provision of any circuits for compensating for the effects of contamination of the optical components.

#### 5.7.2 Test procedure

Adjust the specimen to the maximum sensitivity, and mount and connect in accordance with 5.1.5.

Measure the response threshold value of the specimen in accordance with 5.1.5 but change the filter either continuously or in step in accordance with the minimum filter resolution in Table A.1 (see annex A), with an average rate of Crep/4 dB h<sup>-1</sup> where Crep is the average response threshold values measured in the reproducibility test.

The greater of the response threshold values measured in this test and that measured for the same specimen in the reproducibility test, shall be designated Cmax and the lesser shall be designated Cmin.

#### 5.7.3 Requirements

Cmin shall not be less than 0,4 dB.

The ratio of the response threshold values Cmax: Cmin shall not be greater than 1,6.

#### 5.8 Optical path length dependence

#### 5.8.1 Object

The detector is tested to ensure that the response threshold does not change significantly when it is tested over the minimum and maximum optical path length stated by the manufacturer.

#### 5.8.2 Test procedure

Adjust the specimen to the maximum sensitivity, and mount and connect in accordance with 5.1.5.

With the agreement of the manufacturer this test may be carried out outside of the limits of atmospheric conditions of **5.1.1**.

Measure the response threshold value in accordance with 5.1.5 at the minimum and maximum separations in accordance with the manufacturer's instructions.

The maximum response threshold value shall be designated  $C_{\max}$  and the minimum value shall be designated  $C_{\min}$ .

#### 5.8.3 Requirements

Cmin shall not be less than 0,4 dB.

The ratio of the response threshold values C<sub>max</sub>: C<sub>min</sub> shall not be greater than 1,6.

# EN 54-12:2002 (E) 5.9 Fire sensitivity

#### 5.9.1 Object

The detector is tested to show that the detector has adequate sensitivity to a broad spectrum of smoke types as required for general application in fire detection systems for buildings.

The specimens are mounted in a standard fire test room and are exposed to a series of test fires designed to produce smoke, representative of a wide spectrum of types of smoke and smoke flow conditions.

#### 5.9.2 Test procedure

#### 5.9.2.1 Fire test room

The fire sensitivity tests shall be conducted in a rectangular room with a flat horizontal ceiling, of the following dimensions:

Length: 9 m to 11 m;

Width: 6 m to 8 m;

Height: 3,8 m to 4,2 m.

The fire test room shall be equipped with the following measuring instruments arranged as indicated in annex B:

Measuring ionization chamber (MIC): y value;

Obscuration meter: m value (in dB m<sup>-1</sup>);

Temperature probe: T value (in °C)

The measuring ionization chamber (MIC) and the obscuration meter shall be in accordance with EN 54-7.

#### 5.9.2.2 Test fires

Subject the specimens to the four test fires TF2 to TF5. The type, quantity, condition (e.g. moisture content) and arrangement of the fuel and the method of ignition shall be in accordance with annexes C to F for each test fire, along with the end of the test condition and the required profile curve limits.

In order to be a valid test fire, the development of the fire shall be such that the profile curves of m against y, and m against time fall within the specified limits, up to the time when all of the specimens have generated an alarm signal, or the end of the test condition is reached, whichever is the earlier. If these conditions are not met, the test shall be deemed invalid and repeated.

NOTE It is permissible, and can be necessary, to adjust the quantity and arrangement of the fuel to obtain valid test fires.

#### 5.9.2.3 State of the specimens during the test

Adjust the sensitivity to the minimum recommended for the separation applied, as indicated in manufacturer's data.

Any adjustment for path length or alignment shall be carried out in accordance with the manufacturer's instructions.

Install the specimens on the fire test room ceiling in the designated place, in accordance with annex B.

Mount each specimen in accordance with 5.1.3, connect to its supply and monitoring equipment in accordance with 5.1.2 and allow to stabilize in its quiescent condition before the start of each test fire.

If the size of the test room does not allow the detector to be tested at its maximum specified separation, means agreed by the manufacturer shall be placed in the optical path to simulate the specified separation for this test.

NOTE Detectors which dynamically modify their sensitivity in response to varying ambient conditions, can require special reset procedures and/or stabilization times. The manufacturer's guidance should be sought in such cases to ensure that the state of the detector at the start of each test fire is representative of its normal quiescent state.

#### 5.9.2.4 Initial conditions

Before each test fire clean the specimens and any attenuator(s) in accordance with the manufacturer's guidelines.

Before each test fire ventilate the room with clean air until it is free from smoke and so that the following conditions can be obtained.

Switch off the ventilation system and close all doors, windows and other openings. Allow the air in the room to be stabilized and obtain the following conditions before the test is started:

temperature  $T: (23 \pm 5) ^{\circ}C;$ 

air movement: negligible (see NOTE);

y: ≤ 0,05;

m:  $\leq 0.02 \text{ dB m}^{-1}$ .

NOTE The stability of the air and temperature affects the smoke flow within the room. This is particularly important for the test fires, which produce low thermal lift for the smoke (e.g. TF2 and TF3). It is therefore recommended that the difference between the temperature near the floor and the ceiling is < 2 K, and that local heat sources that can cause convection currents (e.g. lights and heaters) should be avoided. If it is necessary for people to be in the room at the beginning of a test fire, they should leave as soon as possible, taking care to produce minimum disturbance to the air.

#### 5.9.2.5 Recording of the fire parameters and response values

During each test fire record the fire parameters in Table 2 against the time from the start of the test. Each parameter shall be recorded continuously or at least once per second.

Parameter	Symbol	Units
Temperature	dT	К
Smoke density (ionization)	у	dimensionless
Smoke density (optical)	т	dB m <sup>-1</sup>

Table 2 — The fire parameters

The alarm signal given by the supply and monitoring equipment shall be taken as the indication that a specimen has responded to the test fire.

The time of the response of each specimen shall be recorded along with the fire parameters dTa, ya and ma, at the moment of response. Ignore any response of the detector after the end of test condition has been reached.

#### 5.9.3 Requirements

The two specimens shall emit an alarm signal, in each test fire, with  $m_a < 0.7$  dB m<sup>-1</sup>.

#### 5.10 Stray light

#### 5.10.1 Object

The detector is tested to demonstrate its immunity to stray light generated by artificial light sources.

#### 5.10.2 Test procedure

#### **5.10.2.1** Apparatus

The test apparatus shall generally be in accordance with annex G. The test shall be conducted in accordance with 5.10.2.2 to 5.10.2.4.

#### 5.10.2.2 State of specimen during conditioning

Adjust the specimen to the maximum sensitivity and connect in accordance with 5.1.2 for 1 h before the test.

Before the test turn on the fluorescent lamps for a period of 5 min.

#### 5.10.2.3 Conditioning

The following test procedure shall be applied:

- a) all lights: off;
- b) incandescent lights: on for 10 s and off for 10 s, 20 times;
- c) fluorescent lights: on for 10 s and off for 10 s, 20 times;
- d) all lights: on for 2 h.

#### 5.10.2.4 Measurements during conditioning

After the end of period 5.10.2.3 d), and with the lamps on, measure the response threshold value in accordance with 5.1.5 but in the conditions of annex G.

The greater of the response threshold values measured in this test and that measured for the same specimen in the reproducibility test, shall be designated  $C_{\text{max}}$  and the lesser shall be designated  $C_{\text{min}}$ .

#### 5.10.3 Requirements

No alarm or fault signals shall be given during the periods 5.10.2.3 a), b), c) and d).

Cmin shall not be less than 0,4 dB.

The ratio of the response threshold values  $C_{max}$ :  $C_{min}$  shall not be greater than 1,6.

#### 5.11 Dry heat (operational)

#### 5.11.1 Object

The detector is tested to demonstrate its ability to function correctly at high ambient temperatures, which may occur for short periods in the service environment.

#### 5.11.2 Test procedure

#### **5.11.2.1** Apparatus

The test shall be conducted in accordance with EN 60068-2-2:1993, Test Bb and 5.11.2.2 to 5.11.2.6.

#### 5.11.2.2 State of the specimen during conditioning

Adjust the specimen to the maximum sensitivity, and mount and connect in accordance with 5.1.5.

#### 5.11.2.3 Conditioning

The following conditioning shall be applied:

Temperature: (55 ± 2) °C;

Duration:16 h.

#### 5.11.2.4 Measurements during conditioning

The specimen shall be monitored during the conditioning period to detect any alarm or fault signals.

#### 5.11.2.5 Intermediate measurements

At the end of the conditioning period, whilst the specimen is still in the conditioning atmosphere, place an attenuator of value 6 dB in the optical path.

#### 5.11.2.6 Final measurements

After a recovery period of at least 1h at the standard atmospheric conditions, measure the response threshold in accordance with 5.1.5.

The greater of the response threshold values measured in this test and that measured for the same specimen in the reproducibility test, shall be designated  $C_{max}$  and the lesser shall be designated  $C_{min}$ .

#### 5.11.3 Requirements

No alarm or fault signals shall be given during the conditioning.

The detector shall emit an alarm signal no more than 30 s after the total introduction of the attenuator specified in 5.11.2.5.

Cmin shall not be less than 0,4 dB.

The ratio of the response threshold values Cmax: Cmin shall not be greater than 1,6.

#### 5.12 Cold (operational)

#### 5.12.1 Object

The detector is tested to demonstrate its ability to function correctly at low ambient temperatures appropriate to the anticipated service environment.

#### 5.12.2 Test procedure

#### **5.12.2.1** Apparatus

The test shall be conducted in accordance with EN 60068-2-1:1993, Test Ab and 5.12.2.2 to 5.12.2.6.

#### 5.12.2.2 State of the specimen during conditioning

Adjust the specimen to the maximum sensitivity, and mount and connect in accordance with 5.1.5.

#### 5.12.2.3 Conditioning

The following conditioning shall be applied:

Temperature:  $(-10 \pm 3)$  °C;

Duration:16 h.

There shall be no ice or frost on the detector during the conditioning.

#### 5.12.2.4 Measurements during conditioning

Monitor the specimen during the conditioning period to detect any alarm or fault signals.

#### 5.12.2.5 Intermediate measurements

At the end of the conditioning period, whilst the specimen is still in the conditioning atmosphere, place an attenuator of value 6 dB in the optical path.

#### 5.12.2.6 Final measurements

After a recovery period of at least 1 h at the standard atmospheric conditions, measure the response threshold in accordance with 5.1.5.

The greater of the response threshold values measured in this test and that measured for the same specimen in the reproducibility test, shall be designated  $C_{max}$  and the lesser shall be designated  $C_{min}$ .

#### 5.12.3 Requirements

No alarm or fault signals shall be given during the conditioning.

The detector shall emit an alarm signal no more than 30 s after the total introduction of the attenuator specified in 5.12.2.5.

Cmin shall not be less than 0,4 dB.

The ratio of the response threshold values Cmax: Cmin shall not be greater than 1,6.

#### 5.13 Damp heat, steady state (operational)

#### 5.13.1 Object

The detector is tested to demonstrate its ability to function correctly at high relative humidity (without condensation), which may occur for short periods in the anticipated service environment.

#### 5.13.2 Test procedure

#### 5.13.2.1 Apparatus

The test shall be conducted in accordance with HD 323.2.56 S1:1990, Test Cb and 5.13.2.2 to 5.13.2.5.

#### 5.13.2.2 State of the specimen during conditioning

Adjust the specimen to the maximum sensitivity, and mount and connect in accordance with 5.1.5.

#### 5.13.2.3 Conditioning

The following conditioning shall be applied:

Temperature: (40 ± 2) °C;

Relative humidity: (93 ± 3) %;

Duration: 4 days.

#### 5.13.2.4 Measurements during conditioning

Monitor the specimen during the conditioning period to detect any alarm or fault signals.

#### 5.13.2.5 Final measurements

After a recovery period of at least 1 h at the standard atmospheric conditions, measure the response threshold in accordance with 5.1.5.

The greater of the response threshold values measured in this test and that measured for the same specimen in the reproducibility test, shall be designated  $C_{\text{max}}$  and the lesser shall be designated  $C_{\text{min}}$ .

#### 5.13.3 Requirements

No alarm or fault signals shall be given during the conditioning.

Cmin shall not be less than 0,4 dB.

The ratio of the response threshold values  $C_{max}$ :  $C_{min}$  shall not be greater than 1,6.

23

#### 5.14 Damp heat, steady state (endurance)

#### 5.14.1 Object

The detector is tested to demonstrate its ability to withstand the long term effects of humidity in the service environment (e.g. changes in electrical properties of materials, chemical reactions involving moisture, galvanic corrosion).

#### 5.14.2 Test procedure

#### **5.14.2.1** Apparatus

The test shall be conducted in accordance with as described in HD 323.2.56 S1:1990, Test Cb and 5.14.2.2 to 5.14.2.4.

#### 5.14.2.2 State of the specimen during conditioning

Adjust the specimen to the maximum sensitivity and mount in accordance with 5.1.5 but it shall not be supplied with power during the conditioning.

#### 5.14.2.3 Conditioning

The following conditioning shall be applied:

Temperature: (40 ± 2) °C;

Relative humidity: (93 ± 3) %;

Duration:21 days.

#### 5.14.2.4 Final measurements

After a recovery period of at least 1h at the standard atmospheric conditions, measure the response threshold in accordance with 5.1.5.

The greater of the response threshold values measured in this test and that measured for the same specimen in the reproducibility test, shall be designated  $C_{max}$  and the lesser shall be designated  $C_{min}$ .

#### 5.14.3 Requirements

Cmin shall not be less than 0,4 dB.

The ratio of the response threshold values C<sub>max</sub>: C<sub>min</sub> shall not be greater than 1,6.

#### 5.15 Vibration (endurance)

#### 5.15.1 Object

The detector is tested to demonstrate its ability to withstand the long term effects of vibration at levels appropriate to the service environment.

#### 5.15.2 Test procedure

#### **5.15.2.1** Apparatus

The test is conducted in accordance with EN 60068-2-6:1995, Test Fc, and 5.15.2.2 to 5.15.2.4

#### 5.15.2.2 State of the specimen during conditioning

Adjust the specimen to the maximum sensitivity.

Each component (one after the other or together) shall be mounted in accordance with 5.1.3 to a rigid fixture but shall not be supplied with power during conditioning.

The vibration shall be applied in each of three mutually perpendicular axes, in turn. The component shall be mounted so that one of the three axes is perpendicular to its normal mounting axis.

#### 5.15.2.3 Conditioning

The following conditioning shall be applied:

Frequency range: 10 Hz to 150 Hz;

Acceleration amplitude: 9,81 ms<sup>-2</sup>(1,0  $g_{\rm B}$ );

Number of axes: 3:

Sweep rate:1 octave/min;

Number of sweep cycles: 20.

#### 5.15.2.4 Final measurements

After the conditioning, measure the response threshold in accordance with 5.1.5.

The greater of the response threshold values measured in this test and that measured for the same specimen in the reproducibility test, shall be designated *C*max and the lesser shall be designated *C*min.

#### 5.15.3 Requirements

Cmin shall not be less than 0,4 dB.

The ratio of the response threshold values  $C_{max}$ :  $C_{min}$  shall not be greater than 1,6.

#### 5.16 Electromagnetic compatibility (EMC), immunity tests (operational)

The following EMC immunity tests shall be conducted in accordance with EN 50130-

- 4: a) electrostatic discharge;
- b) radiated electromagnetic fields;
- c) conducted disturbances induced by electromagnetic

fields; d) fast transient bursts;

e) slow high energy voltage surges.

For these tests the criteria for compliance specified in EN 50130-4 and the following shall apply:

1) The functional test, called for in the initial and final measurements, shall be a measurement of response threshold values in accordance with 5.1.5.

The initial measurement is the measurement of response threshold value made on the specimen during the reproducibility test;

2) The greater of the response threshold values measured in this test and that measured for the same specimen in the reproducibility test, shall be designated Cmax and the lesser shall be designated Cmin.

The required operating condition shall be in accordance with 5.1.2;

3) The acceptance criterion for the functional test after conditioning shall be as follows:

Cmin shall not be less than 0,4 dB;

The ratio of the response threshold values Cmax: Cmin shall not be greater than 1,6.

#### 5.17 Sulphur dioxide SO<sub>2</sub> corrosion (endurance)

#### 5.17.1 Object

The detector is tested to demonstrate its ability to withstand the corrosive effects of sulphur dioxide as an atmospheric pollutant.

#### 5.17.2 Test procedure

#### **5.17.2.1** Apparatus

The test shall be conducted in accordance with in IEC 60068-2-42:1982, test Kc and 5.17.2.2 to 5.17.2.4.

#### 5.17.2.2 State of the specimen during conditioning

Adjust the specimen to the maximum sensitivity.

The detector shall be mounted in accordance with 5.1.3. It shall not be supplied with power during the conditioning, but it shall have untinned copper wires, of appropriate diameter, connected to sufficient terminals to allow the final measurements to be made, without making further connections to the component(s).

#### 5.17.2.3 Conditioning

The following conditioning shall be applied:

Temperature:(25 ± 2) °C;

Relative humidity: (93 ± 3) %;

SO<sub>2</sub> concentration: a volume fraction of  $(25 \pm 5) \cdot 10^{-6}$ ;

Duration:21 days.

#### 5.17.2.4 Final measurements

Immediately after the conditioning, the specimen shall be subjected to a drying period of 16 h at  $(40 \pm 2)$  °C and a relative humidity not greater than 50 %, followed by a recovery period of 1 h to 2 h at the standard laboratory conditions.

After this recovery period, measure the response threshold as described in 5.1.5.

The greater of the response threshold values measured in this test and that measured for the same specimen in the reproducibility test, shall be designated  $C_{\text{min}}$ .

#### 5.17.3 Requirements

Cmin shall not be less than 0,4 dB.

The ratio of the response threshold values Cmax: Cmin shall not be greater than 1,6.



#### 5.18 Impact (operational)

#### 5.18.1 Object

The detector is tested to demonstrate its immunity to mechanical impacts upon its surface, which it may sustain in the normal service environment and which it can reasonably be expected to withstand.

#### 5.18.2 Test procedure

#### **5.18.2.1** Apparatus

The test shall be conducted in accordance with EN 60068-2-75 and 5.18.2.2 to 5.18.2.5.

#### 5.18.2.2 State of the specimen during conditioning

Adjust the specimen to the maximum sensitivity, and mount and connect in accordance with 5.1.5.

#### 5.18.2.3 Conditioning

The following conditioning shall be applied:

Impact—energy:  $(0.5 \pm 0.04) \text{ J}$ ;

Number of impacts per point: 3.

For each component of the detector in turn, apply impacts to each point on the component which is deemed to be susceptible to mechanical damage that would impair the correct operation of the detector, up to a maximum of 20 points on each component (e.g. lenses, windows and devices used for adjusting alignment may be deemed susceptible to damage). No two points at which the impacts are applied shall be less than 20 mm apart.

Care shall be taken to ensure that the results from one series of three blows do not influence subsequent series. In case of doubt with regard to the influence of preceding blows, the defect shall be disregarded and a further three blows shall be applied to the same position on a new specimen.

#### 5.18.2.4 Monitoring during conditioning

Where the application of the impact apparatus does not obscure the optical beam, monitor the specimen to detect any alarm or fault signals.

#### 5.18.2.5 Final measurements

After the conditioning, measure the response threshold in accordance with 5.1.5.

The greater of the response threshold values measured in this test and that measured for the same specimen in the reproducibility test, shall be designated *C*max and the lesser shall be designated *C*min.

#### 5.18.3 Requirements

No alarm or fault signals shall be given during the conditioning except when the beam is obstructed by the impact apparatus.

Cmin shall not be less than 0,4 dB.

The ratio of the response threshold values  $C_{\text{max}}$ :  $C_{\text{min}}$  shall not be greater than 1,6.

#### 6 Marking and data

#### 6.1 Marking

Each component (receiver, transmitter, transmitter - receiver) shall be clearly marked with the following information: a) the number of this standard (i.e. EN 54-12);

b) the name or the trademark of the manufacturer or supplier; c) the

component designation (type or number);

- d) the wiring terminal designations;
- e) a mark or code (e.g. a serial number or batch code), by which the manufacturer can identify, at least, the date or batch and place of manufacture, and the version number(s) of any software, contained within the detector;
- f) the minimum and maximum separation.

For detachable detectors, the detector head shall be marked with a), b), c), e) and f), and the base shall be marked with, at least c) (i.e. its own model designation) and d).

The information corresponding to c) shall figure clearly on each reflector.

Where any marking on the device uses symbols or abbreviations not in common use then these shall be explained in the data supplied with the device.

The marking shall be visible during installation and shall be accessible during maintenance.

The marking shall not be placed on screws or other easily removable parts.

#### 6.2 Documentation

#### 6.2.1 General

Detectors shall either be supplied with sufficient technical, installation and maintenance data to ensure their correct installation and operation or, if all of these data are not supplied with each detector, reference to the appropriate data sheet be given on, or with each detector. These data shall include at least:

- a) the maximum angular misalignment. If this is different for the transmitter, receiver or reflector or different for vertical or horizontal misalignment, this shall be stated;
- b) the response threshold value of the detector in dB. If the response can be adjusted the minimum and maximum response threshold values, and any setting of response behaviour that does not comply with this standard, shall be stated;
- c) the minimum and maximum separation.

NOTE Additional information may be required by organisations certifying that the detectors produced by a manufacturer conform to the requirements of this standard.

#### 6.2.2 Software documentation

- **6.2.2.1** The manufacturer shall submit documentation which gives an overview of the software design. This documentation shall be in sufficient detail for the design to be inspected for compliance with this standard and shall include at least the following:
- a) a functional description of the main program flow (e.g. as a flow diagram or structogram) including:
  - 1) a brief description of the modules and the functions that they perform;
  - 2)the way in which the modules interact;
  - 3) the overall hierarchy of the program;
  - 4) the way in which the software interacts with the hardware of the detector;
  - 5) the way in which the modules are called, including any interrupt processing.
- b) a description of which areas of memory are used for the various purposes (e.g. the program, site specific data and running data);
- c) a designation, by which the software and its version can be uniquely identified.
- **6.2.2.2** The manufacturer shall have available detailed design documentation, which only needs to be provided if required by the testing authority. It shall comprise at least the following:
- a) an overview of the whole system configuration, including all software and hardware components;
- b) a description of each module of the program, containing at least:
  - 1) the name of the module;
  - 2) a description of the tasks performed;
  - 3) a description of the interfaces, including the type of data transfer, the valid data range and the checking for valid data.
- c) full source code listings, as hard copy or in machine-readable form (e.g. ASCII-code), including all global and local variables, constants and labels used, and sufficient comment for the program flow to be recognised;
- d) details of any software tools used in the design and implementation phase (e.g. compilers).

# **Annex A**

(normative)

## Bench for response threshold value measurements

#### A.1 Technical characteristics of the attenuators


To simulate the effect of smoke on the detector, an attenuation shall be achieved by obscuration with a filter (agreed by the detector's manufacturer) covering the complete optics of the receiver.

Filters shall be neutral over the spectral wavelength band used for the detector.

Table A.1 — Minimum resolution for optical density filters

Filter obscuration	Minimum resolution
dB	dB
less than 1,0	0,1
1,0 to 1,9	0,2
2,0 to 3,9	0,3
4,0 to 6,0	0,4
more than 6,0	1,0

#### A.2 Measuring bench

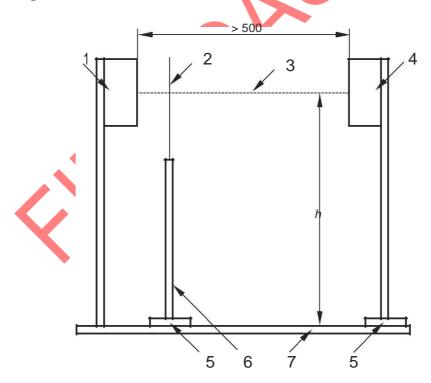

#### Key

- 1 Receiver or transmitter receiver
- 2 Attenuator
- 3 Axis of beam
- 4 Transmitter or reflector

- 5 Adjustment of the distance
- 6 Adjustment of the height
- 7 Support
- h Height of the axis of beam above the support

Figure A.1 - Optical bench arrangement

Key

#### **Annex B**

(normative)

#### Fire test room


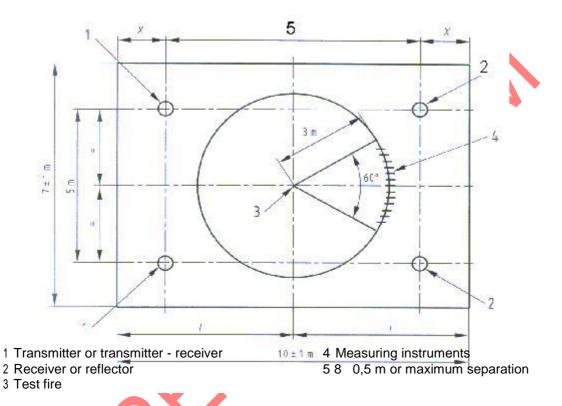


Figure B.1 - Plan view of detectors, position of fire and measuring instruments

The specimens shall be mounted such that the optical axis is at the distance from the ceiling as defined by the manufacturer.

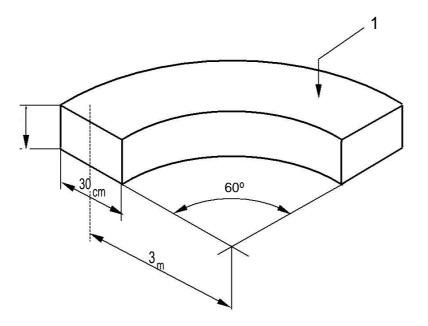

Key

1 Ceiling

Figure B.2 - Mounting positions for measuring instruments

The Measuring Ionization Chamber (MIC), the temperature probe and the measuring part of obscuration meter shall be within the above volume.

The MIC, and the mechanical parts of the obscuration meter shall be at least 100 mm apart, measured to the nearest edges.

#### **Annex C**

#### (normative)

#### **Smouldering pyrolysis wood fire (TF2)**

#### C.1 Fuel

Approximately 10 dried beechwood sticks (moisture content  $\approx 5$  %), each stick having dimensions of approximately 75 mm x 25 mm x 20 mm.

#### C.2 Hotplate

The hotplate shall have a 220 mm diameter grooved surface with 8 concentric grooves, each being 2 mm deep and 5 mm wide, with the outer groove 4 mm from the edge and a distance of 3 mm between grooves. The hotplate shall have a rating of approximately 2 kW.

The temperature of the hotplate surface shall be measured by a sensor attached to the 5th groove, counted from the edge of the hotplate, and secured to provide a good thermal contact.

#### **C.3 Arrangement**

The sticks shall be arranged on the grooved hotplate surface, with the 20 mm side in contact with the surface such that the temperature probe lies between the sticks and is not covered, as shown in Figure C.1.



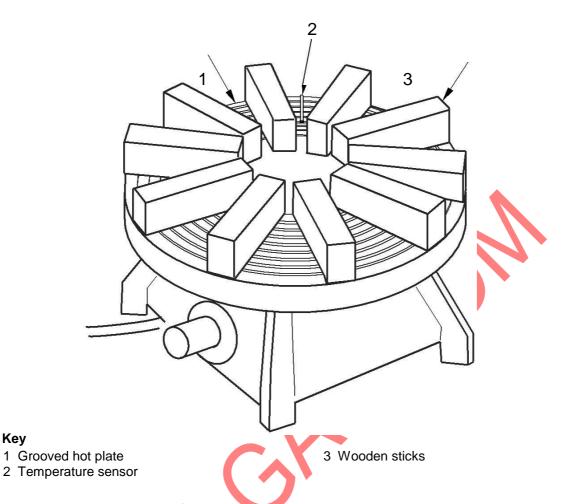


Figure C.1 — Arrangement of the sticks on the hotplate

#### C.4 Heating rate


The hotplate shall be powered such that a temperature of 600 °C is reached in approximately 11 min and that flaming does not occur during the test.


#### C.5 End of test condition

 $mE = 2 \text{ dB m}^{-1}$ 

#### C.6 Test validity criteria

The development of the fire shall be such that the curves of m against y, and m against time, fall within the limits shown in Figures C.2 and C.3 respectively, up to the time when both of the specimens have generated an alarm signal, or m = 2 dB m<sup>-1</sup>, whichever is the earlier.

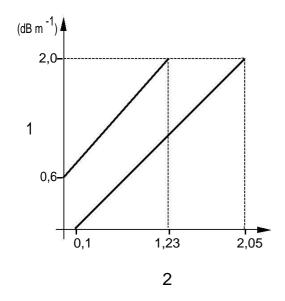

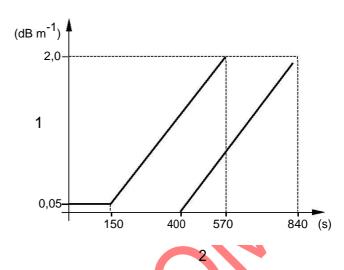

#### Key

- 1 m value
- 2 y value

Figure C.2 - Fire TF2 limits for *m* against *y* 

#### Key

- 1 m value
- 2 Time

Figure C.3 – Fire TF2 limits for *m* against time

# Annex D

(normative)

#### **Glowing smouldering cotton fire (TF3)**

#### D.1 Fuel

Approximately 90 pieces of woven cotton wick, each approximately 80 cm long and weighing approximately 3 g. The wicks shall be free from any protective coating and shall be washed and dried if necessary.

#### **D.1.1 Arrangement**

The wicks shall be fastened to a ring approximately 10 cm in diameter and suspended over a non-combustible plate as shown in Figure D.1.

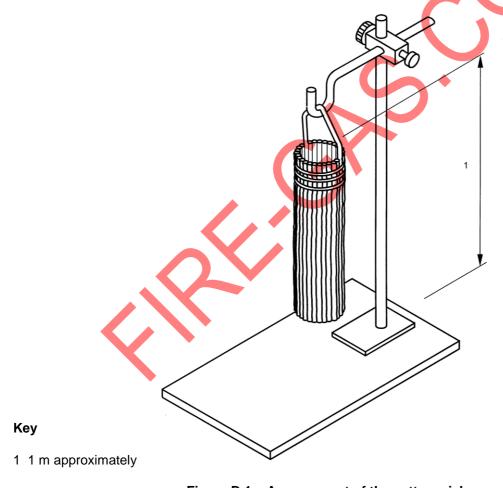


Figure D.1 – Arrangement of the cotton wicks

#### **D.2 Ignition**

The lower end of each wick shall be ignited so that the wicks continue to glow. Any flaming shall be blown out immediately.

#### D.3 End of test condition

$$mE = 2 \text{ dB m}^{-1}$$

#### D.4 Test validity criteria

The development of the fire shall be such that the curves of m against y, and m against time, fall within the limits shown in Figures D.2 and D.3 respectively, up to the time when both of the specimens have generated an alarm signal, or m = 2 dB m<sup>-1</sup>, whichever is the earlier.


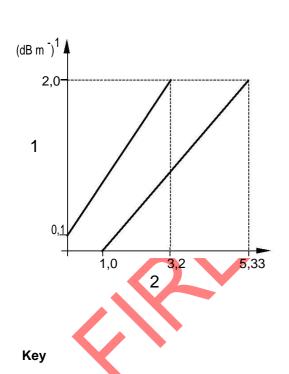


Figure D.2 – Fire TF3 limits for *m* against *y* 

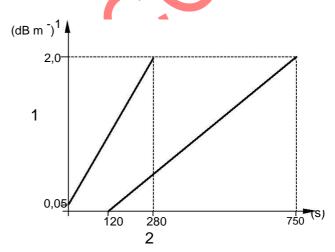

#### Key

- 1 m value
- 2 Time

Figure D.3 - Fire TF3 limits for *m* against time

1 m value

2 y value

# Annex E

(normative)

# Flaming plastics (polyurethane) fire (TF4)

#### E.1 Fuel

Three mats approximately 50 cm x 50 cm x 2 cm, made of soft polyurethane foam, without flame retardant additives, having a density of approximately  $20 \text{ kg/m}^3$ .

#### **E.2** Arrangement

The mats shall be placed one on top of another on a base formed from aluminium foil with the edges folded up to provide a tray.

#### **E.3** Ignition

The mats shall normally be ignited at a corner of the lower mat.

NOTE1 The exact position of ignition may be adjusted to obtain valid tests.


NOTE 2 A small quantity of a clean burning material (e.g. 5 cm<sup>3</sup> of methylated spirit) can be used to assist the ignition.

#### E.4 End of test condition

yE = 6

#### E.5 Test validity criteria

The development of the fire shall be such that the curves of m against y, and m against time, fall within the limits shown in Figures E.1 and E.2 respectively, up to the time when both of the specimens have generated an alarm signal, or y = 6, whichever is the earlier.

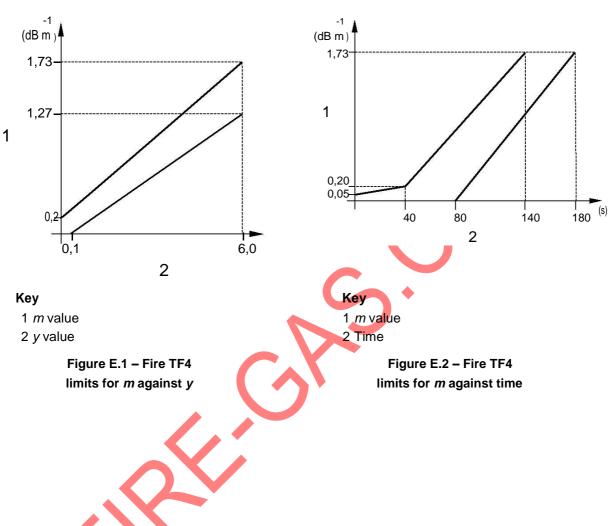

#### **Annex F**

(normative)

# Flaming liquid (n-heptane) fire (TF5)

#### F.1Fuel

Approximately 650 g of a mixture of n-heptane (purity  $\geq$  99 %) with approximately 3 % of toluene (purity  $\geq$  99 %), by volume.

NOTE The precise quantities may be varied to obtain valid tests.

#### F.2 Arrangement

The heptane/toluene mixture shall be burnt in a square steel tray with dimensions approximately 33 cm x 33 cm x 5 cm.

#### F.3Ignition

Ignition shall be by, for example, flame or spark.


#### F.4 End of test condition


yE = 6

#### F.5 Test validity criteria

The development of the fire shall be such that the curves of *m* against *y*, and *m* against time, fall within the limits

shown in Figures F.1 and F.2 respectively, up to the time when both of the specimens have generated an alarm signal, or y = 6, whichever is the earlier.

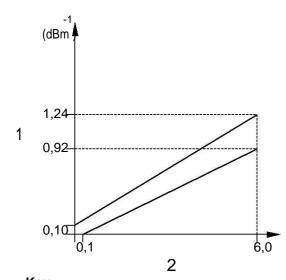

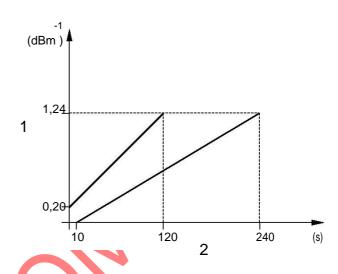

**Key**1 *m* value
2 *y* value

Figure F.1 - Fire TF5 limits for *m* against *y* 

**Key** 1 *m* value 2 Time

Figure F.2 - Fire TF5 limits for *m* against time

#### **Annex G**

(normative)

# **Apparatus for stray light**


#### **G.1 Installation**


Mount the components of the detector on two rigid supports separated by longitudinal distance of

 $(10 \pm 1)$  m, or separated by the maximum separation of the detector if less than 10 m.

Simulate the maximum separation given by the manufacturer if greater than 10 m.

Care. shall be taken with the electrical connections to the fluorescent lamps and the ancillary equipments to avoid electrical interference with the detection system.



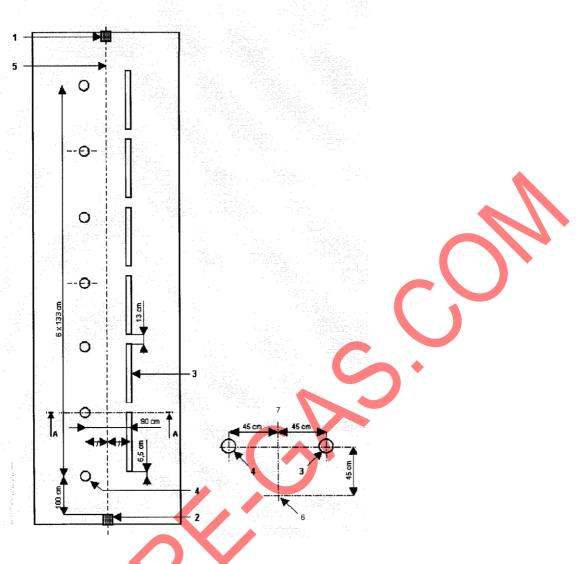

- Key
- 1 Transmitter or reflector
- 2 Receiver or transmitter receiver
- 3 Tubular fluorescent lamps (Nb: 6)
- 4 Incandescent lamps (Nb: 7)
- 5 Axis of beam
- 6 Centre line of optical beam 7 Section A-A

Figure G.1 – Installation for stray light

#### **G.2 The light source**

The light source shall consist of:

a) seven identical 100 W tungsten incandescent lamps, with an approximate colour temperature

of 2 900 K; and

b) six identical 36 W tubular fluorescent lamps, 1,2 m long, with an approximate colour temperature of 6 500 K (day light).

The incandescent lamps shall be pear-shaped with clear glass envelopes and shall conform to EN 60064.

The tubular fluorescent lamps shall conform to EN 60081.

To obtain a stable output of light, the fluorescent lamps shall be aged for 100 h before the initial use and discarded after 2 000 h.

The light source shall be supplied with a 50 Hz alternating current.



# Annex ZA

(informative)

# Clauses of this European Standard addressing essential requirements or other provisions of EU Directives

#### ZA.1 Scope and relevant characteristics

This European Standard has been prepared under the mandate M/109 given to CEN by the European Commission and the European Free Trade Association.

The clauses of this European Standard, shown in this Annex, meet the requirements of the Mandate given under the EU Construction Products Directive (89/106/EEC).

Compliance with these clauses confers a presumption of fitness of the construction product covered by this European Standard for its intended use according to clause 1 (Scope) of this standard.

**WARNING:** Other requirements and other EU Directives <u>may</u> be applicable to the product(s) falling within the scope of this standard.

NOTE In addition to any specific clauses relating to dangerous substances contained in this Standard, there may be other requirements applicable to the products falling within its scope (e.g. transposed European legislation and national laws, regulations and administrative provisions). These requirements need also to be complied with, when and where they apply.

An informative database of European and national provisions on dangerous substances is available at the Construction web site on EUROPA (CREATE, accessed through http://europa.eu.int)

This Annex has the same scope, in relation to the products covered, as clause 1 of this standard. This Annex establishes the conditions for the CE marking of control and indicating equipment intended for the use shown below and identifies the relevant clauses applicable.

This Annex establishes the conditions for the CE marking of line detectors using an optical beam intended for the use shown below and identifies the relevant clauses applicable.



Construction product: Line detector using an optical beam.

Intended use:Fire Safety.

Table ZA.1 - Relevant clauses

Essential characteristics	Clauses in this European Standard	Mandated levels or classes		
Nominal activation conditions/ sensitivity	4.5, 4.8, 4.10, 5.2, 5.4, 5.7, 5.8, 5.9, 5.10			
Response delay (response time)	5.3, 5.6	•		
Operational reliability	4.3, 4.4, 4.6, 4.7, 5.16, 5.18, 4.9 <sup>a</sup>			
Tolerance to supply voltage	5.5			
Performance parameters under fire conditions	4.2			
	5.11, 5.12			
Durability of operational reliability; vibration resistance	5.15			
humidity resistance	5.13, 5.14			
Durability of operational reliability; corrosion resistance	5.17			
Tolerance to supply voltage	5.5			
<sup>a</sup> Applies only to software controlled detector				

#### ZA.2 Procedures for the attestation of conformity of line detector using an optical beam

#### **ZA.2.1 Attestation of conformity**

#### ZA.2.1.1 System of attestation of conformity

The mandate requires that the attestation of conformity system to be applied shall be that shown in Table ZA.2.

Table ZA.2 - Attestation of conformity system

Product	Intended use	Levels or classes	Attestation of conformity system	
Line detector using an optical beam	Fire safety		1	
System 1: see CPD Annex III.2(i), without audit-testing of samples.				

This requires:

- a) Tasks to be provided by the manufacturer:
  - 1) factory production control (see ZA.2.2b));
  - 2) testing of samples taken at the factory by the manufacturer in accordance with a prescribed test plan;
- b) Tasks to be undertaken under the authority of a Notified Product Certification Body <sup>1</sup>:
  - 1) type testing of the product (see ZA.2.2a));
  - 2) inspection of the factory and factory production control;
  - 3) continuous/periodic surveillance, assessment and approval of the factory production control.

#### **ZA.2.2 Evaluation of conformity**

The evaluation of conformity of a line detector using an optical beam covered by this European Standard shall be by the following:

a) Type testing

Type testing of the product shall be carried out in accordance with the clauses shown in Table ZA.1, before the CE marking CE is affixed. The products tested shall be representative of the manufacturer's normal production with regard to their construction, operation and calibration.

Tests previously performed in accordance with the provisions of this standard may be taken into account providing that they were made to the same system of attestation of conformity on the same product or products of similar design, construction and functionality, such that the results may be considered applicable to the product in question.

Wherever a change, for example in the product design, materials or supplier of the components or of the production process occurs, which could change significantly one or more of the characteristics, the type testing shall be repeated for the relevant product performance.

b) Factory production control

The manufacturer shall establish, document and maintain a permanent factory production control system to ensure that the products placed on the market conform with the stated performance characteristics.

The factory production control system shall consist of procedures, regular inspections and tests and/or assessments and the use of the results to control incoming materials or components, equipment, the production process and the product.

The production control procedure shall be adequately extensive and detailed so that the conformity of the products is made apparent to the manufacturer and so that irregularities can be detected at the earliest possible stage.

A factory production control system conforming with the requirements of EN ISO 9001, and made specific to the requirements of this standard, shall be considered to satisfy the above requirements.

The production control procedure shall be recorded in a manual, which shall be made available for inspection.

<sup>1 )</sup> A Notified Product Certification Body is an approved product certification body notified to the Commission by a member state, for this purpose, in accordance with article 18 of the Construction Products Directive (89/106/EEC).

The factory production control shall be recorded. These records shall be available for inspection and shall include at least the following:

identification of the product

tested; the dates of sampling;

the test methods applied; the

test and inspection results;

the date of tests:

the identification of the responsible authority within the factory;

calibration records;

actions taken.

#### **ZA.3 CE Marking**

The CE marking symbol (in accordance with Directive 93/68/EEC) shall be placed on the product and be accompanied by:


- i) the identification number of the Notified Product Certification Body; and
- ii) the number of the EC certificate of conformity.

The CE marking symbol shall in addition be shown on the packaging and/or on the accompanying commercial documentation supplemented by

- a) the identification number of the Notified Product Certification Body;
- b) the name or identifying mark and registered address of the manufacturer;
- c) the last two digits of the year in which the marking was affixed;
- d) the number of the EC certificate of conformity;
- e) the reference to this European Standard (EN 54-12);
- f) the description of the product and intended use (line detector using an optical beam; fire safety);
- g) the reference to documentation required in 6.2.

Where the product exceeds the minimum performance levels stated in this standard, and where the manufacturer so desires, the CE marking may be accompanied by an indication of the parameter(s) concerned and the actual test result(s).

Figure ZA.1 gives an example of the information to be shown on the accompanying commercial documents.



AnyCo Ltd, P.O. Box21, B1050 01 0123 – CPD - 001

EN54-12

Line detector using an optical beam Fire safety

Documentation: see doc.123/2000

Figure ZA.1 - Example of CE marking

#### ZA.4 EC certificate and declaration of conformity

The manufacturer or his agent established in the EEA, shall prepare and retain a declaration of conformity, which authorises the affixing of the CE marking. This declaration shall include:

name and address of the manufacturer, or his authorised representative established in the EEA, and the place of production;

description of the product (type, identification, use), and a copy of the information accompanying the CE marking; provisions to which the product conforms (e.g. Annex ZA of this standard);

if necessary, particular conditions applicable to the use of the product;

name and address or identification number of the Notified Product Certification Body;

name of and position held by the person empowered to sign the declaration on behalf of the manufacturer or of his authorized representative.

The declaration shall contain a certificate of conformity with, in addition to the information above, the following information:


the name and address of the Notified Product Certification

Body; the certificate number;

conditions and period of validity of the certificate, where applicable;

name of and position held by the person empowered to sign the certificate.

The above mentioned declaration and certificate shall be presented (if requested) in the official language or languages of the Member State in which the product is to be used.



# **Bibliography**

EN ISO 9001 Quality management systems - Requirements (ISO 9001:2000).



#### BS EN 54-12:2002

### **BSI** — British Standards Institution

BSI is the independent national body responsible for preparing British Standards. It presents the UK view on standards in Europe and at the international level. It is incorporated by Royal Charter.

#### Revisions

British Standards are updated by amendment or revision. Users of British Standards should make sure that they possess the latest amendments or editions.

It is the constant aim of BSI to improve the quality of our products and services. We would be grateful if anyone finding an inaccuracy or ambiguity while using this British Standard would inform the Secretary of the technical committee responsible, the identity of which can be found on the inside front cover. Tel: +44 (0)20 8996 9000. Fax: +44 (0)20 8996 7400.

BSI offers members an individual updating service called PLUS which ensures that subscribers automatically receive the latest editions of standards.

#### **Buying standards**

Orders for all BSI, international and foreign standards publications should be addressed to Customer Services. Tel: +44 (0)20 8996 9001. Fax: +44 (0)20 8996 7001. Email: orders@bsi-global.com. Standards are also available from the BSI website at <a href="http://www.bsi-global.com">http://www.bsi-global.com</a>.

In response to orders for international standards, it is BSI policy to supply the BSI implementation of those that have been published as British Standards, unless otherwise requested.

#### Information on standards

BSI provides a wide range of information on national, European and international standards through its Library and its Technical Help to Exporters Service. Various BSI electronic information services are also available which give details on all its products and services. Contact the Information Centre.

Tel: +44 (0)20 8996 7111. Fax: +44 (0)20 8996 7048. Email: info@bsi-global.com.

Subscribing members of BSI are kept up to date with standards developments and receive substantial discounts on the purchase price of standards. For details of these and other benefits contact Membership Administration.

Tel: +44 (0)20 8996 7002. Fax: +44 (0)20 8996 7001. Email: membership@bsi-global.com.

Information regarding online access to British Standards via British Standards Online can be found at <a href="http://www.bsi-global.com/bsonline">http://www.bsi-global.com/bsonline</a>.

Further information about BSI is available on the BSI website at http://www.bsi-global.com.

#### Copyright

Copyright subsists in all BSI publications. BSI also holds the copyright, in the UK, of the publications of the international standardization bodies. Except as permitted under the Copyright, Designs and Patents Act 1988 no extract may be reproduced, stored in a retrieval system or transmitted in any form or by any means – electronic, photocopying, recording or otherwise – without prior written permission from BSI.

This does not preclude the free use, in the course of implementing the standard, of necessary details such as symbols, and size, type or grade designations. If these details are to be used for any other purpose than implementation then the prior written permission of BSI must be obtained.

Details and advice can be obtained from the Copyright & Licensing Manager. Tel: +44 (0)20 8996 7070. Fax: +44 (0)20 8996 7553. Email: copyright@bsi-global.com.

BSI 389 Chiswick High Road London W4 4AL

# Adjustment: Ali Mohammad Akhavan

Date :10 June 2017

